

WEDA D70 ESF

Spare Parts List Dewatering Pumps

WEDA D70 ESF s/n ESF116563 -



General information

Use only authorized parts. Any damage or malfunction caused by the use of unauthorized parts is not covered by Warranty or Product Liability. Any unauthorized use or copying of the contents or any part thereof is prohibited. This applies in particular to trademarks, model denominations, part numbers, and drawings.

Instructions for use

This spare parts list contains no safety regulations and is merely intended to assist in the ordering of spare parts.

For information about operating, servicing, or repairing, the relevant Safety and operating instructions must be consulted at all costs.

Please observe the safety instructions listed in the relevant Safety and operating instructions!


Kits and consumables	1
Overview	3
Top housing unit	5
Starter unit terminal board 6L	7
Starter unit Y/D starter	9
Starter unit soft starter 380-400V D 50Hz	11
Starter unit soft starter toroid trafo 415-440V D 50Hz	13
Starter unit soft starter toroid trafo 500V D 50Hz	15
Starter unit soft starter toroid trafo 525-550V D 50Hz	17
Starter unit soft starter 380-400V Y 60Hz	19
Starter unit soft starter toroid trafo 440-480V D 60Hz	21
Starter unit soft starter toroid trafo 575-600V D 60Hz	23
Starter unit contactor overload relay 500V D 50Hz	25
Starter unit contactor overload relay / toroid trafo 500V D 50Hz	27
Starter unit contactor overload relay / toroid trafo 525-550V D 50Hz	29
Starter unit contactor Overload relay / toroid trafo 660-690V Y 50Hz	31
Starter unit contactor control relay / overload relay 220-240V D 50Hz	33
Starter unit contactor control relay / overload relay 380-400V D 50Hz	35
Starter unit contactor control relay / overload relay 415-440V D 50Hz	37
Starter units contactor control relay / overload relay toroid trafo 415-440V D 50Hz	39
Starter unit contactor overload relay / toroid trafo 575-600V D 60Hz	41
Starter unit contactor control relay / overload relay 220-240V D 60Hz	43
Starter unit contactor control relay / overload relay 380-400V Y 60Hz	45
Starter unit contactor control relay / overload relay 440-480V D 60Hz	47
Starter units contactor control relay / overload relay toroid trafo 440-480V D 60Hz	49
Motor unit	51
Shaft unit	53
Seal unit	55
Wet end unit WEDA D70H 50/60 Hz	57
Wet end unit WEDA D70L 50/60 Hz	59
Discharge unit 6-4" HOSE	61
Discharge unit 6-4" BSP/NPT	63
Discharge unit 6-6" BSP/NPT	65
Discharge unit 6-6" HOSE	67
Cable unit 4G2,5	69
Cable unit 4G4	71
Cable unit 4G6	73
Cable unit 4G10	75
Cable unit 4AWG10	77
Cable unit 4AWG8	79
Cable unit	81
Plug kit	83
Float switch unit	85
O-Ring kit	87
Zinc anode kit	89

Kits and consumables

Kits and consumables	Item Number	Description	Change Interval / Quantity	
			6 Months/ 2000 hours	When Needed
Seal unit kits	1	Oil can 1 Litre/ 0.26 Gallen	3.9 Litre/ 1.04 Gallon	4
Service and repair kits	2	Zinc anodes unit		1
	3	O-ring kit		1
Wear parts kits	4	Wear parts kit WEDA D70L 50Hz		1
	5	Wear parts kit WEDA D70L 60Hz		1
	6	Wear parts kit WEDA D70H 50Hz		1
	7	Wear parts kit WEDA D70H 60Hz		1


Item	Part No.	Name	Qty	L
1	1636302422	Oil can 1 Liter/0.26 Gallon	4	
2	3081690918	Zinc anode kit	1	
3	470W274414	O-ring kit	1	
4	3081690359	Wear parts kit WEDA D70L 50Hz	1	
5	3081690360	Wear parts kit WEDA D70L 60Hz	1	
6	3081690361	Wear parts kit WEDA D70H 50Hz	1	
7	3081690362	Wear parts kit WEDA D70H 60Hz	1	

Overview

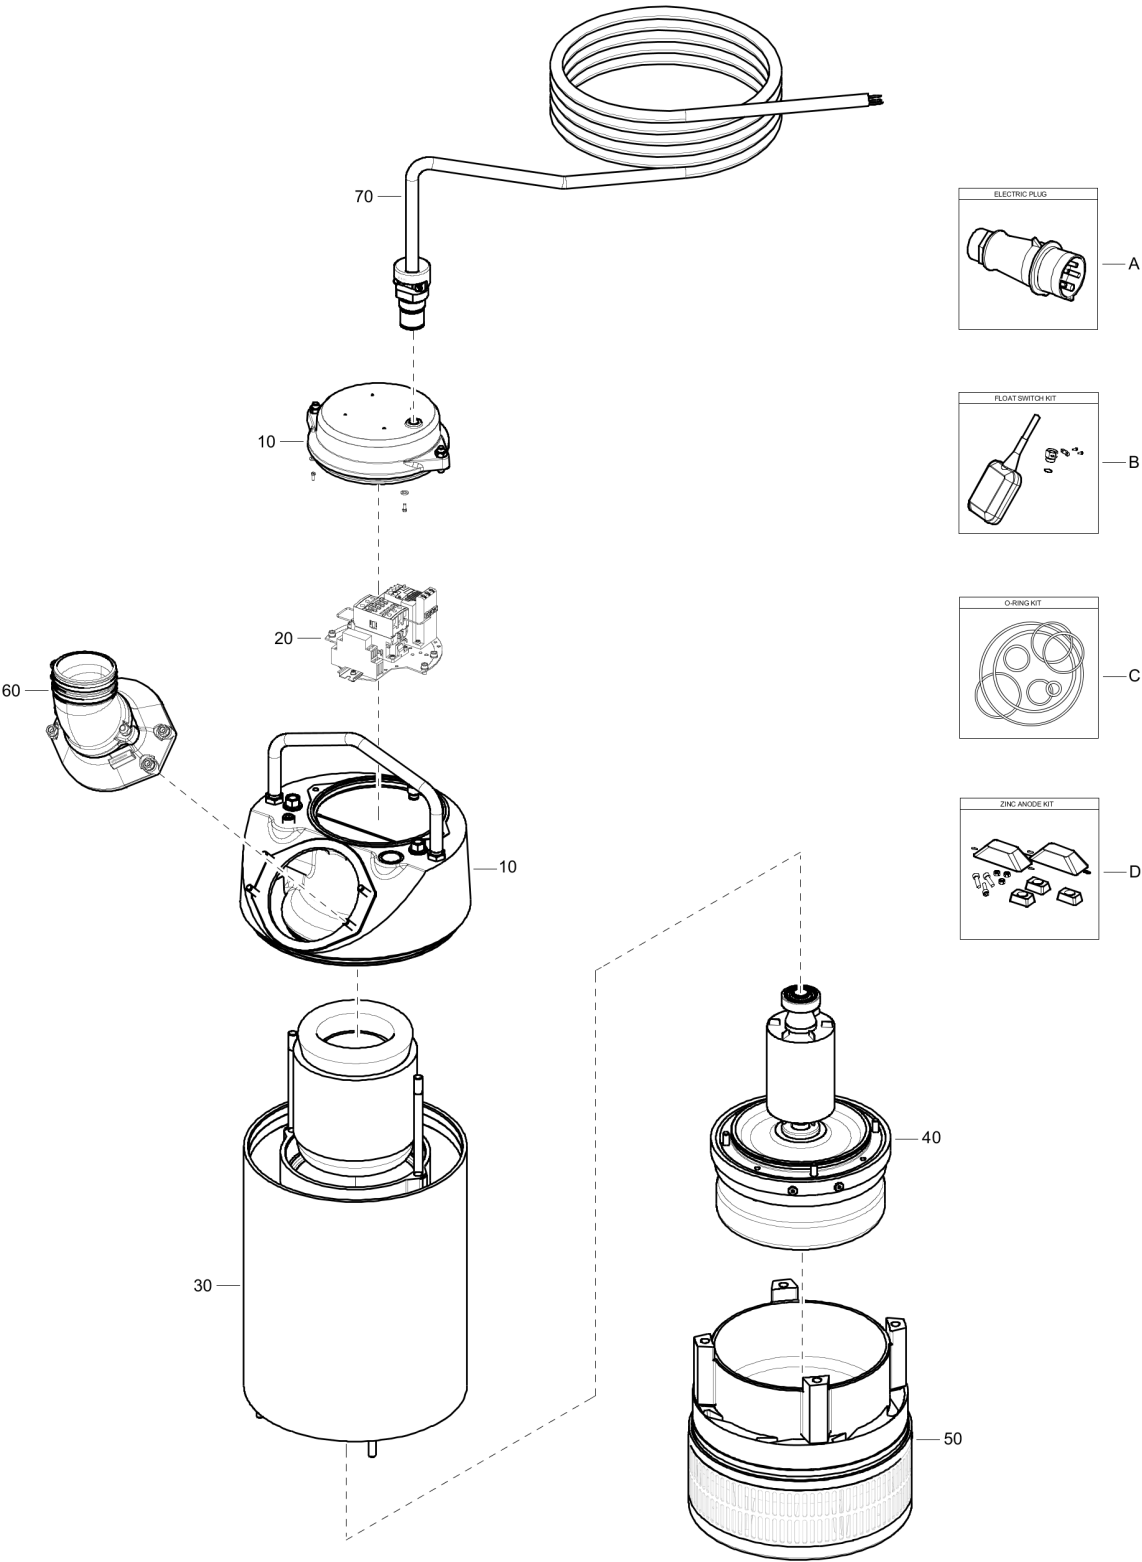

Item	Part No.	Name	Qty	L
10	-	Top housing unit	1	
20	-	Starter unit	1	
30	-	Motor unit	1	
40	-	Shaft unit	1	
50	-	Wet end unit	1	
60	-	Discharge unit	1	
70	-	Cable unit	1	
A	-	Plug CEE kit	1	
B	-	Float switch unit	1	
C	-	O-ring unit	1	
D	-	Zinc anode unit	1	

Top housing unit

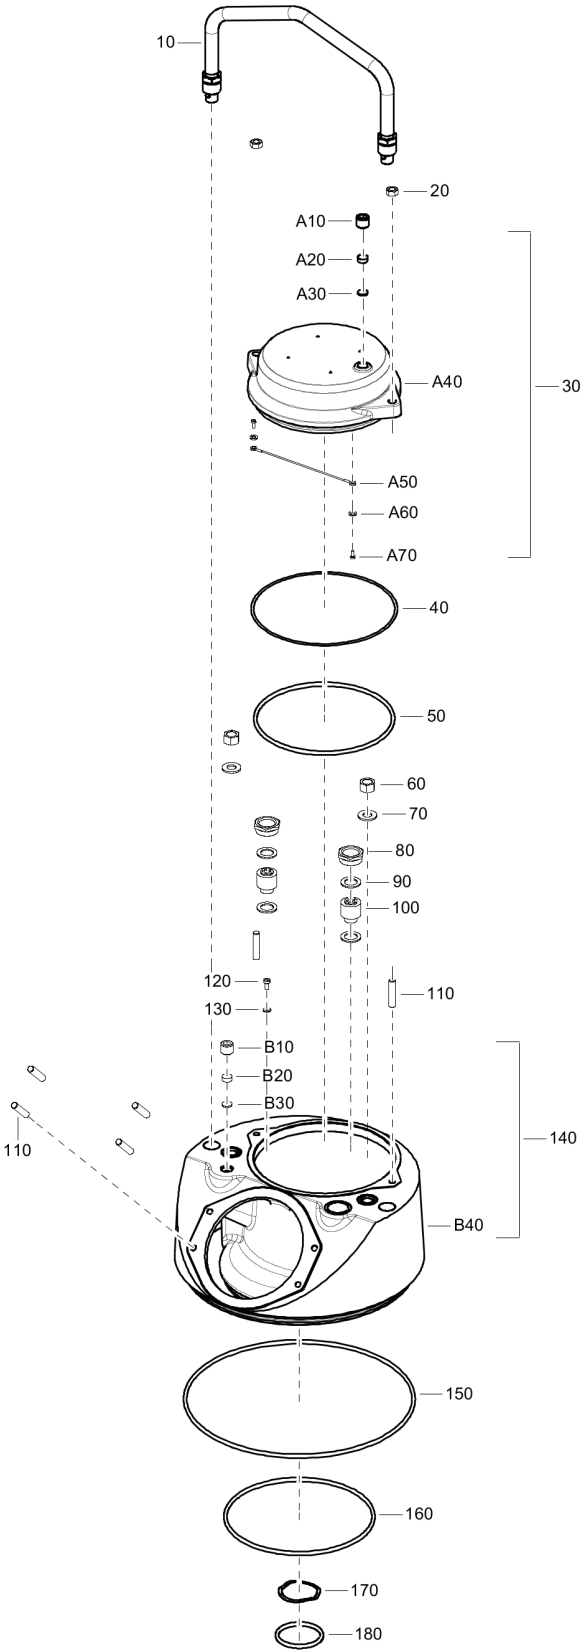


Refer to Parts Online for the most up to date information. The printed information might be outdated.

Fri Apr 24 06:38:42 UTC 2020

Item	Part No.	Name	Qty	L
10	470W272040	Handle	1	
20	5541062500	Nut DIN 934	2	
30	3081690318	Top cover kit	1	
A10	470W214828	Pipe plug DIN906 3/8" L=10mm	1	
A20	470W214829	Gasket (rubber)	1	
A30	470W214833	Washer	1	
A40	3081601274	Top cover	1	
A50	1605274900	Cable Gn/Ye CPL	1	
A60	0333210837	Lock washer	2	
A70	4700W78698	Screw DIN84-M6x10-ISO:A2(A4)	2	
40	4700W65164	O-ring 210X3-NBR 70 shore	1	
50	4700W65130	O-ring 199,3X5,7-NBR 70 shore	1	
60	0261109106	Nut DIN 934 M14 A2 ISO 4032	2	
70	0300027673	Washer DIN 125 Ø15 A2 ISO 7089	2	
80	470W294127	Screw fitting	2	
90	470W294126	Washer	4	
100	470W254408	Rubber wire inlet sealing	2	
110	4700W69642	Stud DIN938-M10x35-ISO:A2-70	6	
120	4700W78699	Screw DIN84-M6x12-ISO:A2(A4)	1	
130	0333210837	Lock washer	1	
140	3081690859	Top bracket kit	1	
B10	470W214828	Pipe plug DIN906 3/8" L=10mm	1	
B20	470W214829	Gasket (rubber)	1	
B30	470W214833	Washer	1	
B40	3081600542	Top bracket	1	
150	4700W65141	O-ring 319,3X5,7-NBR 70 shore	1	
160	4700W65131	O-ring 209,3X5,7-NBR 70 shore	1	
170	3081602092	Wave spring	1	
180	470W274062	O-ring 62,2X5,7-NBR 70 shore	1	

Starter unit terminal board 6L

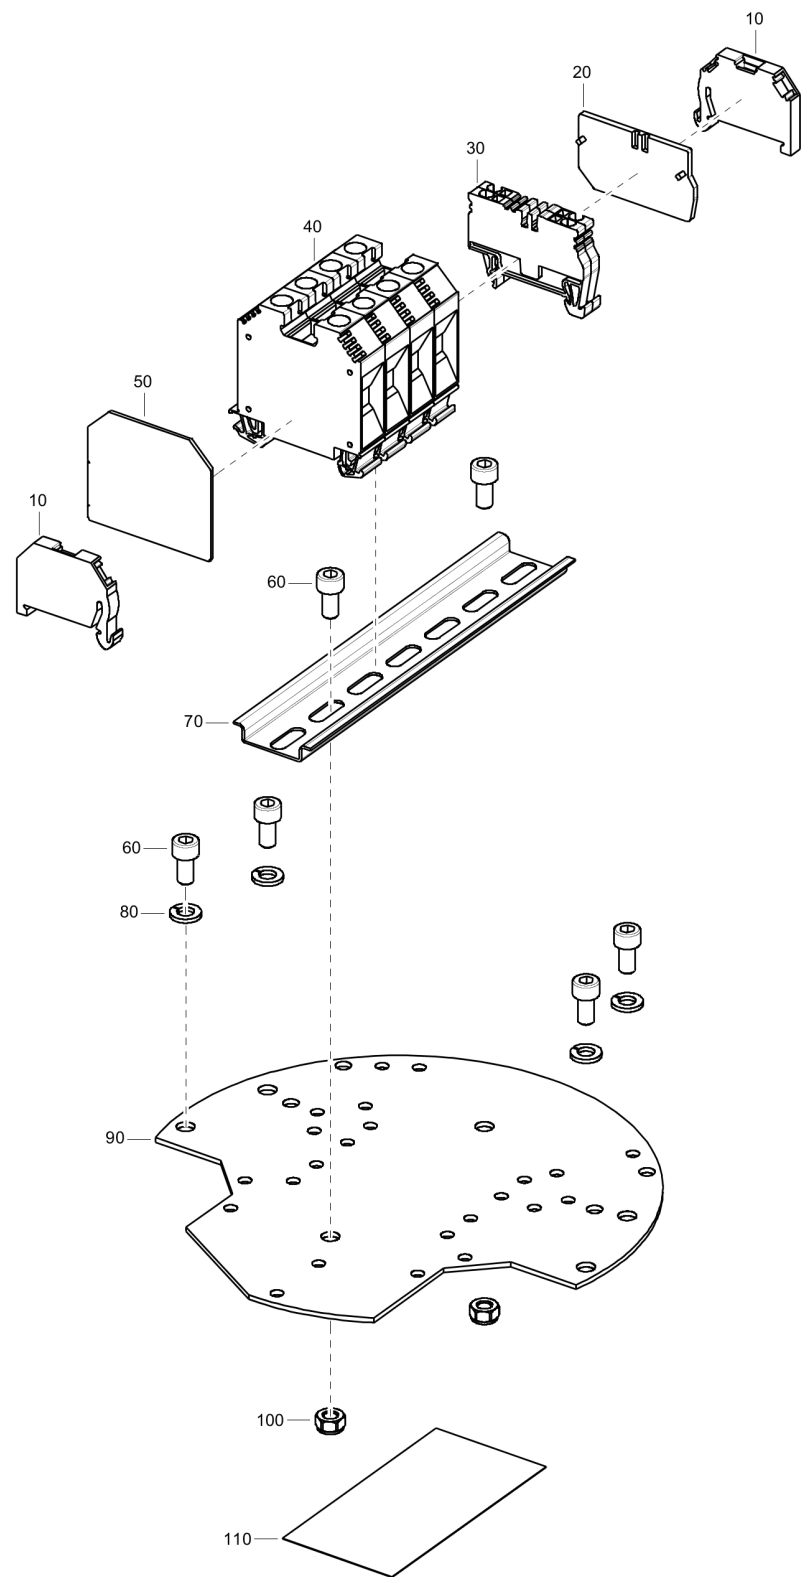


Refer to Parts Online for the most up to date information. The printed information might be outdated.

Fri Apr 24 06:38:42 UTC 2020


Item	Part No.	Name	Qty	L
10	1089057782	Plate	2	
20	1636000079	Terminal cap push in	1	
30	1636000080	Terminal push in	2	
40	3081601833	Terminal screw conn. 35mm ²	4	
50	1636000224	Terminal cap	1	
60	4700W75654	Screw DIN912-M6x12-ISO:A2-70	6	
70	1605264400	Rail 35/7.5, 172mm	1	
80	0333210837	Lock washer	4	
90	3081601953	Plate	1	
100	1633010650	Lock nut DIN 985 M6 A2 ISO 10511	2	
110	3081600597	Wiring diagram 6-lead terminal board	1	

Starter unit Y/D starter

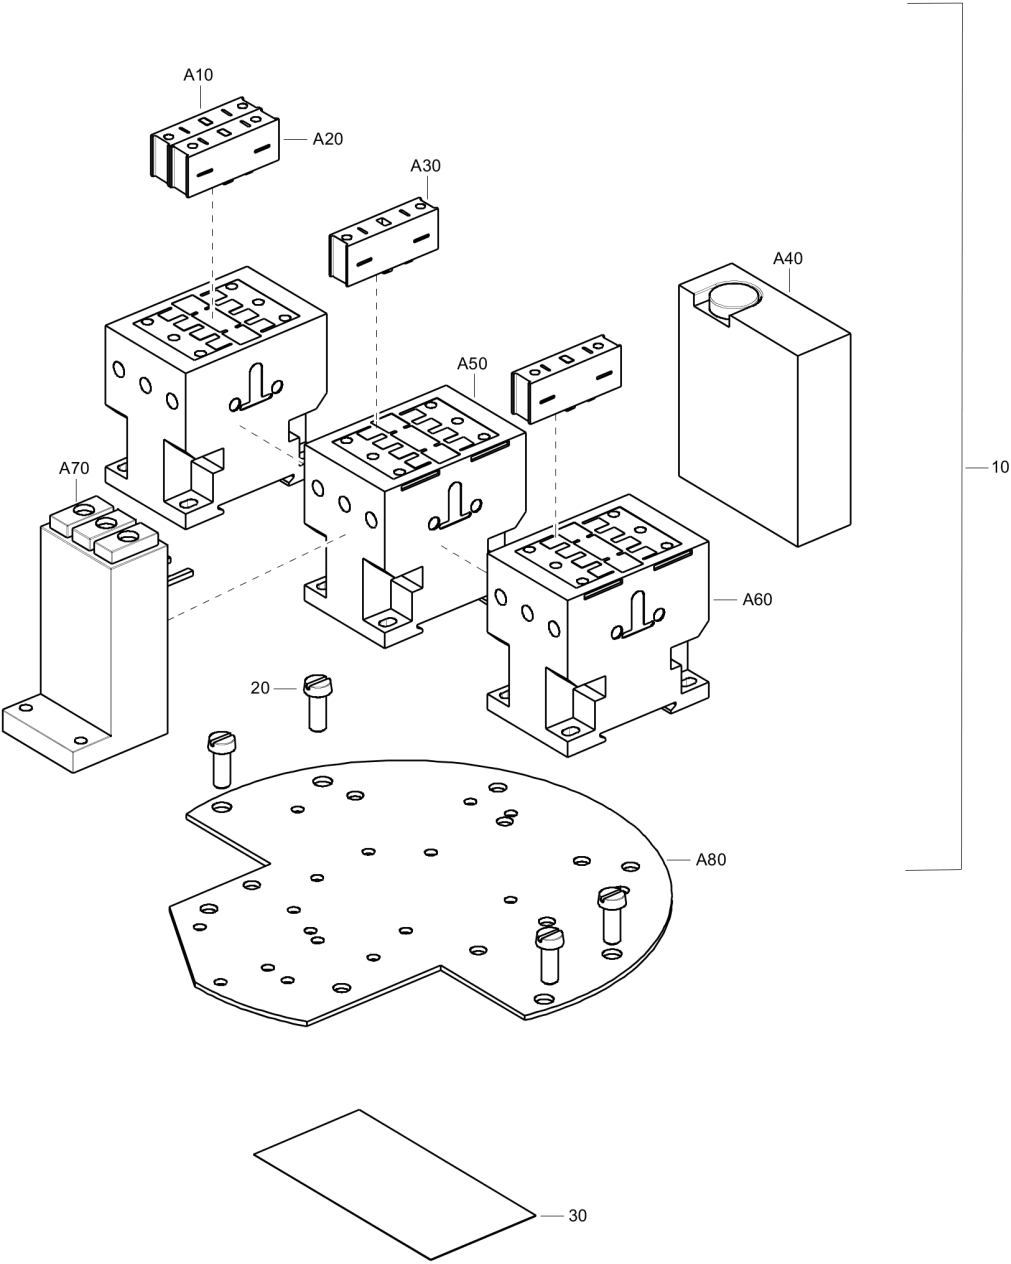

Item	Part No.	Name	Qty	L
10	470W299580	Y/D starter 400V 50Hz	1	
A10	3081601419	Auxiliary contact block	1	
A20	3081601420	Auxiliary contact block	2	
A30	3081601423	Auxiliary contact block	1	
A40	3081601421	Time relay	1	
A50	3081601424	Contactor YD 32A	2	
A60	3081601422	Contactor YD 25A	1	
A70	3081601418	Overload relay 10-14A,YD 18-24A	1	
A80	470W273068	Contactor plate	1	
20	4700W78701	Screw DIN84-M6x16-ISO:A2(A4)	4	
30	470W368967	Wiring diagram	1	

Starter unit soft starter 380-400V D 50Hz

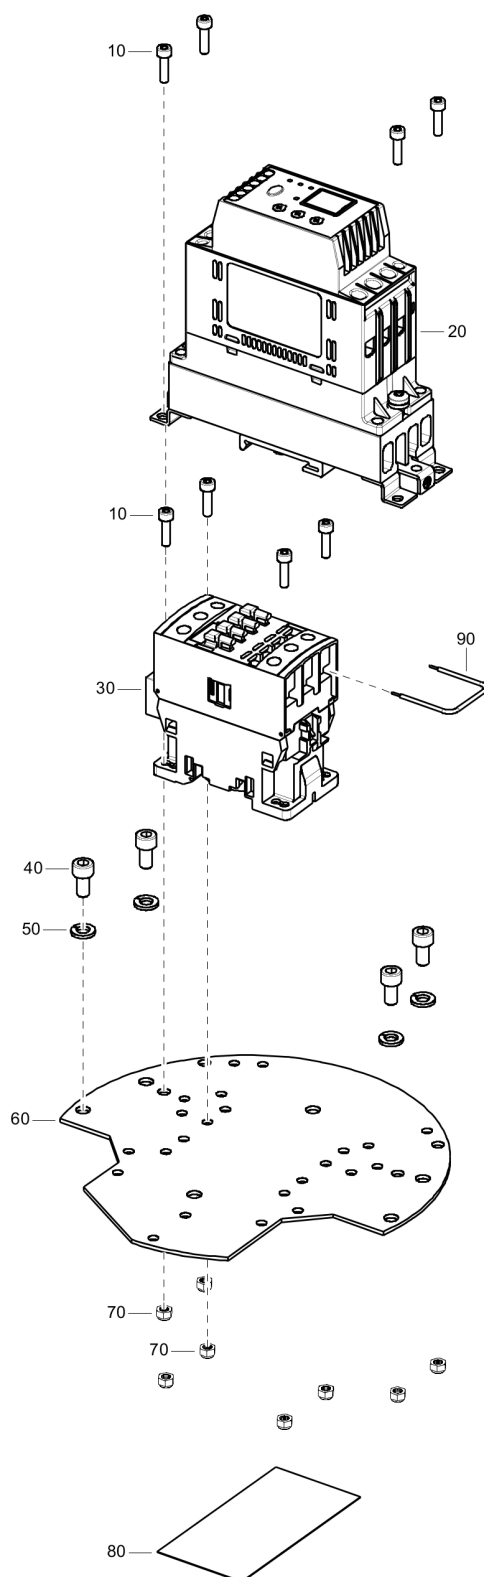


Refer to Parts Online for the most up to date information. The printed information might be outdated.

Fri Apr 24 06:38:43 UTC 2020

Item	Part No.	Name	Qty	L
10	1633010701	Screw DIN912 M4x15 A2-70 ISO 4762	8	
20	3081601579	Soft starter 220-400V 110-400V 32A RMS	1	
30	3081601756	Contactor AF30Z 100-250V 220-440V,32A,500V,28A,690V,21A	1	
40	4700W75654	Screw DIN912-M6x12-ISO:A2-70	4	
50	0333210837	Lock washer	4	
60	3081601953	Plate	1	
70	470W209785	Lock nut DIN 985 M4 A2	8	
80	3081601461	Wiring diagram 6-lead soft starter	1	
90	3081601751	Wire CPL	3	

Starter unit soft starter toroid trafo 415-440V D 50Hz

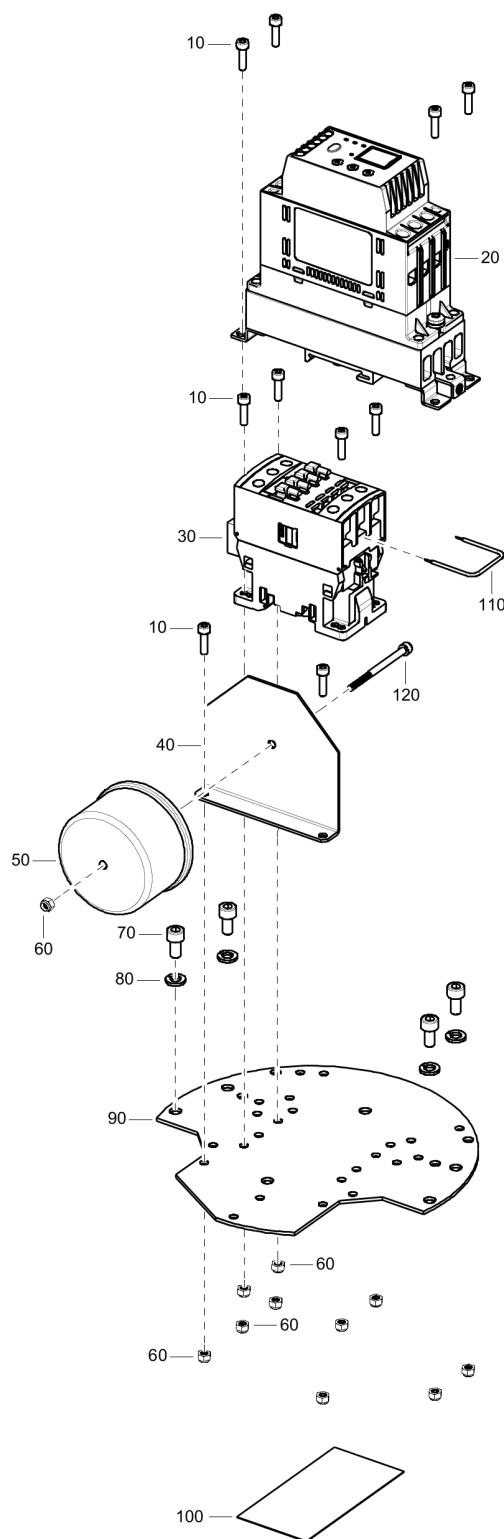


Refer to Parts Online for the most up to date information. The printed information might be outdated.

Fri Apr 24 06:38:44 UTC 2020

Item	Part No.	Name	Qty	L
10	1633010701	Screw DIN912 M4x15 A2-70 ISO 4762	10	
20	3081601580	Soft starter 220-600V 100-240V 32A RMS	1	
30	3081601755	Contacto AF26Z 100-250V	1	
40	3081601954	Bracket	1	
50	3081602077	Toroid trafo 30VA 3:1	1	
60	470W209785	Lock nut DIN 985 M4 A2	11	
70	4700W75654	Screw DIN912-M6x12-ISO:A2-70	4	
80	0333210837	Lock washer	4	
90	3081601953	Plate	1	
100	3081601461	Wiring diagram 6-lead soft starter	1	
110	3081601751	Wire CPL	3	
120	3081602082	Screw DIN 912 M4x55 8.8 A2	1	

Starter unit soft starter toroid trafo 500V D 50Hz

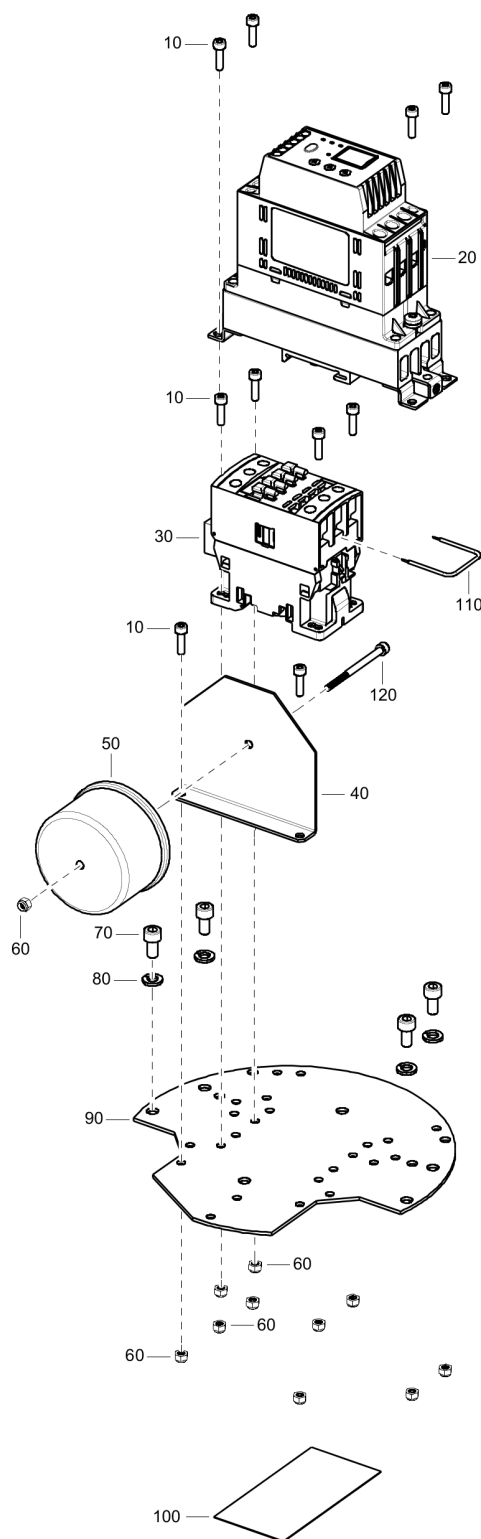


Refer to Parts Online for the most up to date information. The printed information might be outdated.

Fri Apr 24 06:38:44 UTC 2020

Item	Part No.	Name	Qty	L
10	1633010701	Screw DIN912 M4x15 A2-70 ISO 4762	10	
20	3081601580	Soft starter 220-600V 100-240V 32A RMS	1	
30	3081601755	Contacto AF26Z 100-250V	1	
40	3081601954	Bracket	1	
50	3081602077	Toroid trafo 30VA 3:1	1	
60	470W209785	Lock nut DIN 985 M4 A2	11	
70	4700W75654	Screw DIN912-M6x12-ISO:A2-70	4	
80	0333210837	Lock washer	4	
90	3081601953	Plate	1	
100	3081601461	Wiring diagram 6-lead soft starter	1	
110	470W367170	Wire CPL	3	
120	3081602082	Screw DIN 912 M4x55 8.8 A2	1	

Starter unit soft starter toroid trafo 525-550V D 50Hz

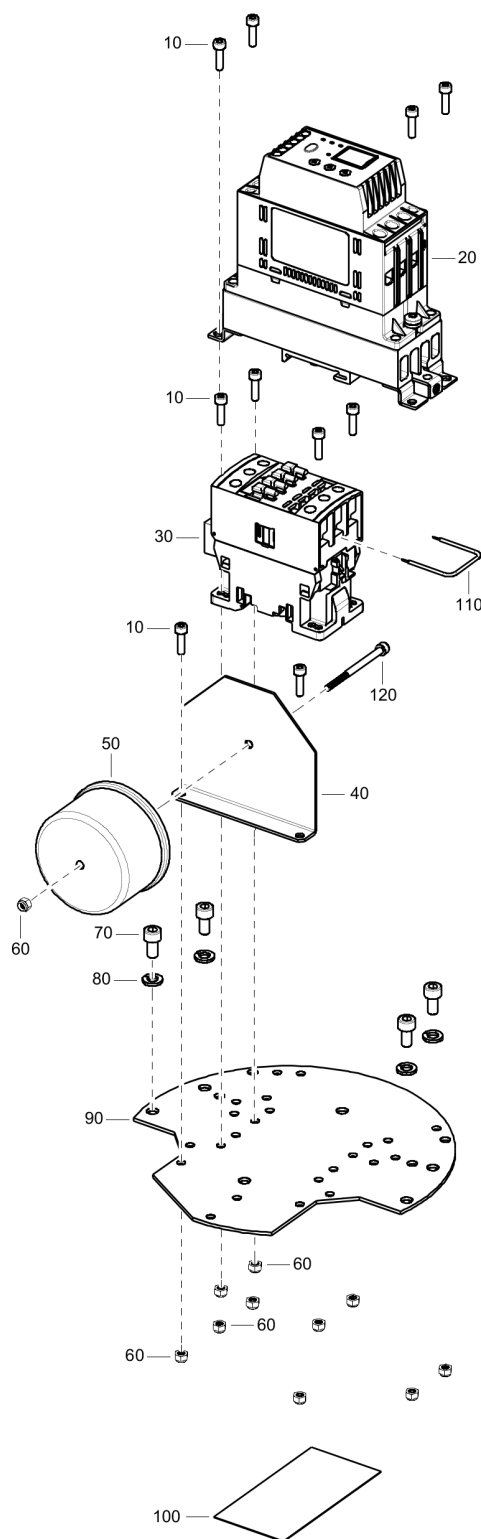


Refer to Parts Online for the most up to date information. The printed information might be outdated.

Fri Apr 24 06:38:45 UTC 2020

Item	Part No.	Name	Qty	L
10	1633010701	Screw DIN912 M4x15 A2-70 ISO 4762	10	
20	3081601580	Soft starter 220-600V 100-240V 32A RMS	1	
30	3081601755	Contacto AF26Z 100-250V	1	
40	3081601954	Bracket	1	
50	3081602077	Toroid trafo 30VA 3:1	1	
60	470W209785	Lock nut DIN 985 M4 A2	11	
70	4700W75654	Screw DIN912-M6x12-ISO:A2-70	4	
80	0333210837	Lock washer	4	
90	3081601953	Plate	1	
100	3081601461	Wiring diagram 6-lead soft starter	1	
110	470W367170	Wire CPL	3	
120	3081602082	Screw DIN 912 M4x55 8.8 A2	1	

Starter unit soft starter 380-400V Y 60Hz

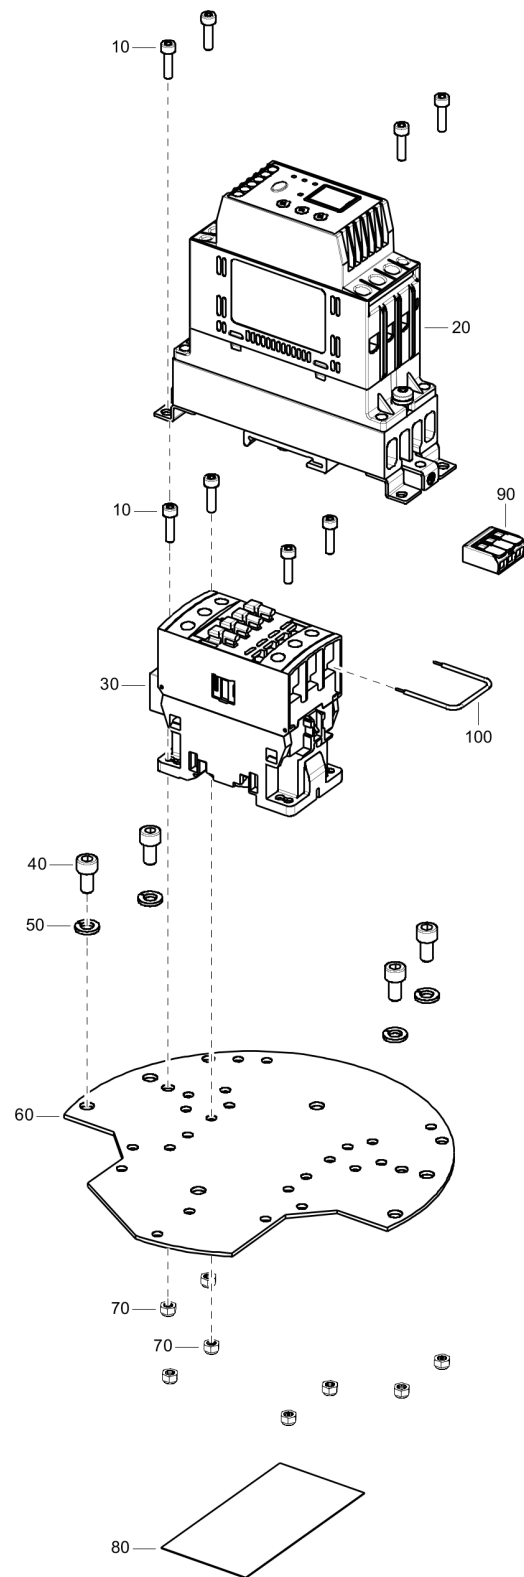


Refer to Parts Online for the most up to date information. The printed information might be outdated.

Fri Apr 24 06:38:46 UTC 2020

Item	Part No.	Name	Qty	L
10	1633010701	Screw DIN912 M4x15 A2-70 ISO 4762	8	
20	3081601579	Soft starter 220-400V 110-400V 32A RMS	1	
30	3081601756	Contacto AF30Z 100-250V 220-440V,32A,500V,28A,690V,21A	1	
40	4700W75654	Screw DIN912-M6x12-ISO:A2-70	4	
50	0333210837	Lock washer	4	
60	3081601953	Plate	1	
70	470W209785	Lock nut DIN 985 M4 A2	8	
80	3081601461	Wiring diagram 6-lead soft starter	1	
90	3081602100	Connector	1	
100	3081601751	Wire CPL	3	

Starter unit soft starter toroid trafo 440-480V D 60Hz

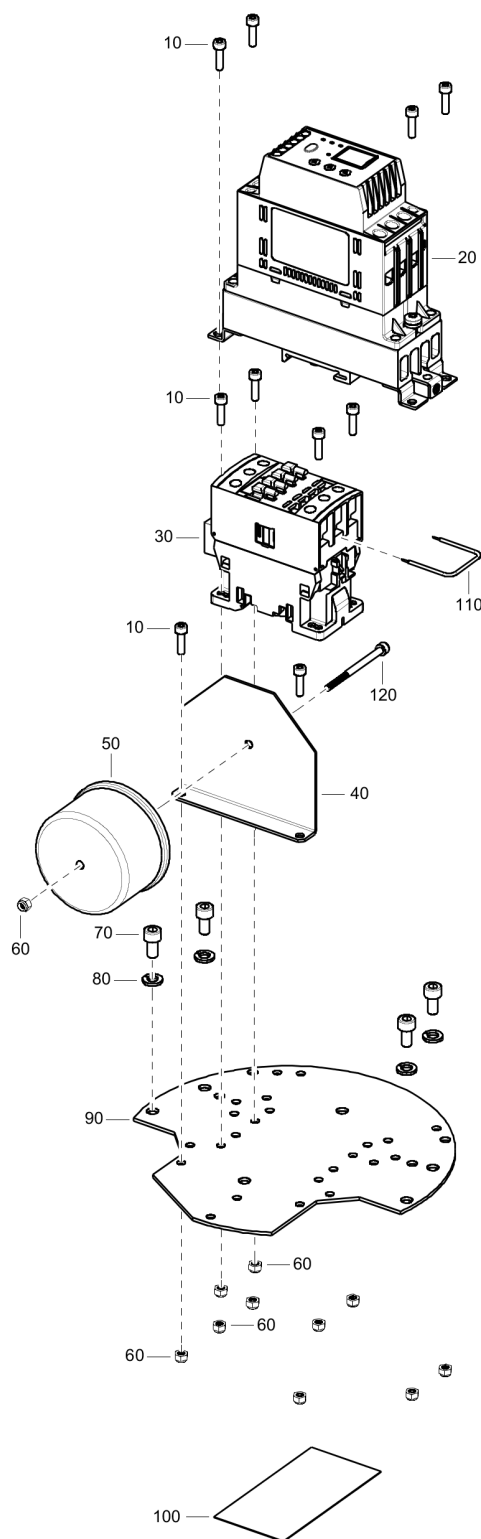


Refer to Parts Online for the most up to date information. The printed information might be outdated.

Fri Apr 24 06:38:46 UTC 2020

Item	Part No.	Name	Qty	L
10	1633010701	Screw DIN912 M4x15 A2-70 ISO 4762	10	
20	3081601580	Soft starter 220-600V 100-240V 32A RMS	1	
30	3081601755	Contacto AF26Z 100-250V	1	
40	3081601954	Bracket	1	
50	3081602077	Toroid trafo 30VA 3:1	1	
60	470W209785	Lock nut DIN 985 M4 A2	11	
70	4700W75654	Screw DIN912-M6x12-ISO:A2-70	4	
80	0333210837	Lock washer	4	
90	3081601953	Plate	1	
100	3081601461	Wiring diagram 6-lead soft starter	1	
110	470W367170	Wire CPL	3	
120	3081602082	Screw DIN 912 M4x55 8.8 A2	1	

Starter unit soft starter toroid trafo 575-600V D 60Hz

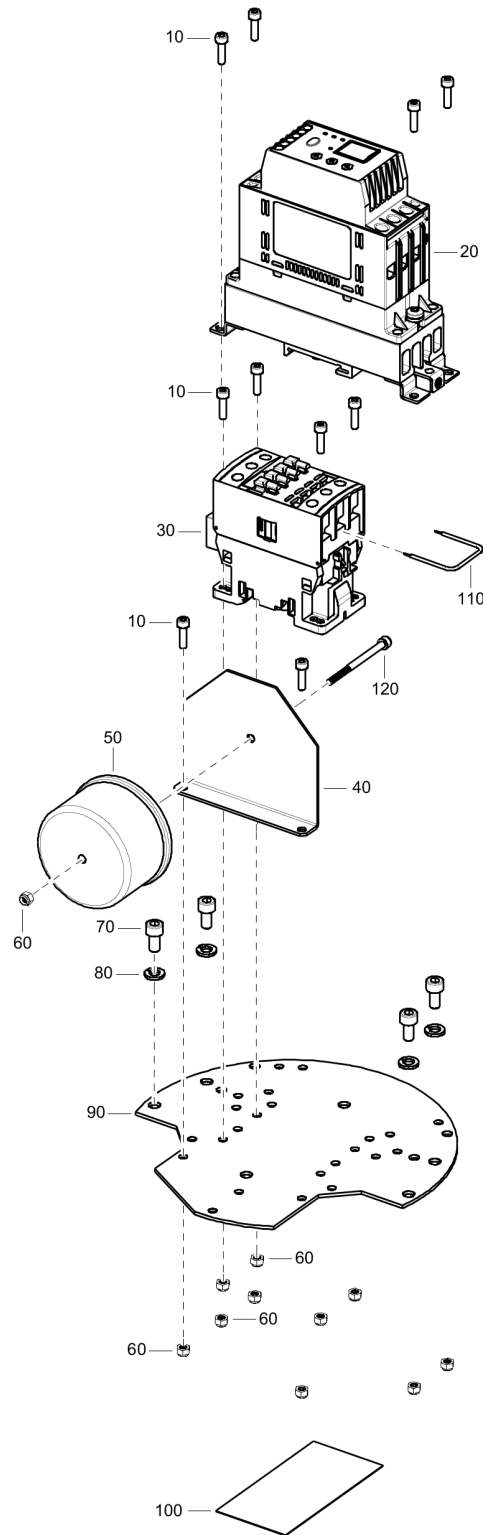


Refer to Parts Online for the most up to date information. The printed information might be outdated.

Fri Apr 24 06:38:47 UTC 2020

Item	Part No.	Name	Qty	L
10	1633010701	Screw DIN912 M4x15 A2-70 ISO 4762	10	
20	3081601580	Soft starter 220-600V 100-240V 32A RMS	1	
30	3081601755	Contacto AF26Z 100-250V	1	
40	3081601954	Bracket	1	
50	3081602077	Toroid trafo 30VA 3:1	1	
60	470W209785	Lock nut DIN 985 M4 A2	11	
70	4700W75654	Screw DIN912-M6x12-ISO:A2-70	4	
80	0333210837	Lock washer	4	
90	3081601953	Plate	1	
100	3081601461	Wiring diagram 6-lead soft starter	1	
110	470W367170	Wire CPL	3	
120	3081602082	Screw DIN 912 M4x55 8.8 A2	1	

Starter unit contactor overload relay 500V D 50Hz

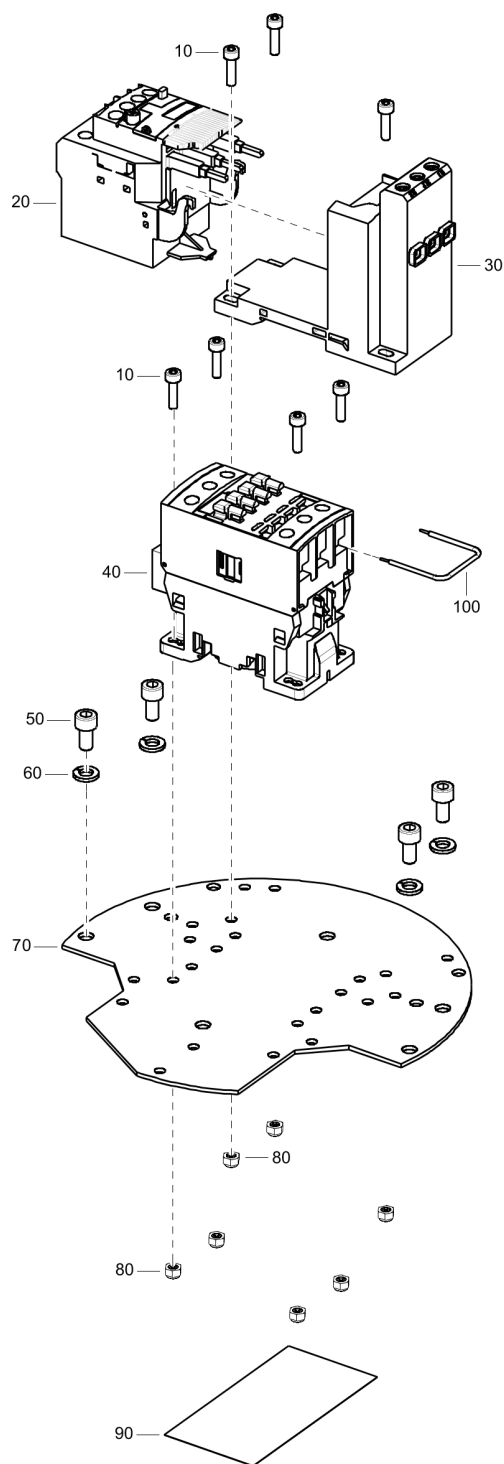


Refer to Parts Online for the most up to date information. The printed information might be outdated.

Fri Apr 24 06:38:47 UTC 2020

Item	Part No.	Name	Qty	L
10	1633010701	Screw DIN912 M4x15 A2-70 ISO 4762	7	
20	3081601937	Overload relay 20-24A	1	
30	3081601549	Mounting kit DB42 for TF42	1	
40	3081601756	Contactor AF30Z 100-250V 220-440V,32A,500V,28A,690V,21A	1	
50	4700W75654	Screw DIN912-M6x12-ISO:A2-70	4	
60	0333210837	Lock washer	4	
70	3081601953	Plate	1	
80	470W209785	Lock nut DIN 985 M4 A2	7	
90	3081600594	Wiring diagram 6-lead Y & D connection	1	
100	470W367170	Wire CPL	3	

Starter unit contactor overload relay / toroid trafo 500V D 50Hz

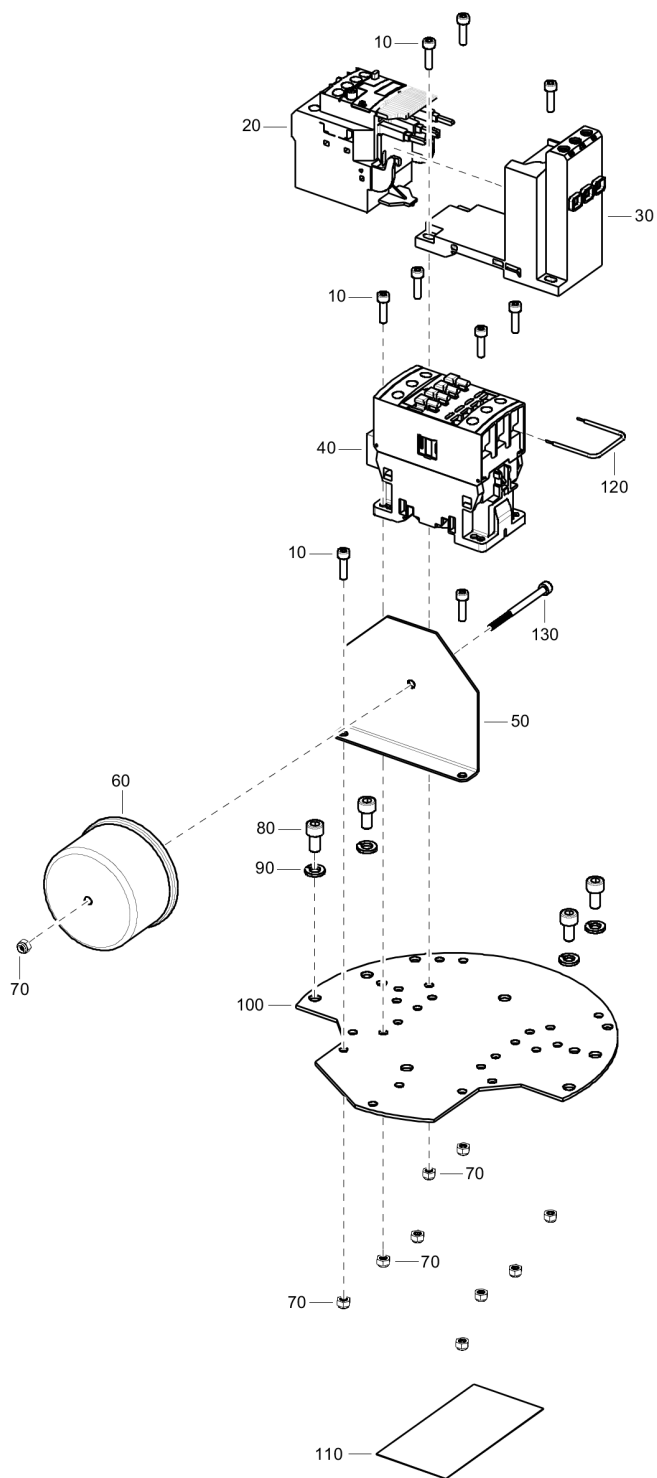


Refer to Parts Online for the most up to date information. The printed information might be outdated.

Fri Apr 24 06:38:48 UTC 2020

Item	Part No.	Name	Qty	L
10	1633010701	Screw DIN912 M4x15 A2-70 ISO 4762	9	
20	3081601937	Overload relay 20-24A	1	
30	3081601549	Mounting kit DB42 for TF42	1	
40	3081601755	Contactor AF26Z 100-250V	1	
50	3081601954	Bracket	1	
60	3081602077	Toroid trafo 30VA 3:1	1	
70	470W209785	Lock nut DIN 985 M4 A2	10	
80	4700W75654	Screw DIN912-M6x12-ISO:A2-70	4	
90	0333210837	Lock washer	4	
100	3081601953	Plate	1	
110	3081600594	Wiring diagram 6-lead Y & D connection	1	
120	470W367170	Wire CPL	3	
130	3081602082	Screw DIN 912 M4x55 8.8 A2	1	

Starter unit contactor overload relay / toroid trafo 525-550V D 50Hz

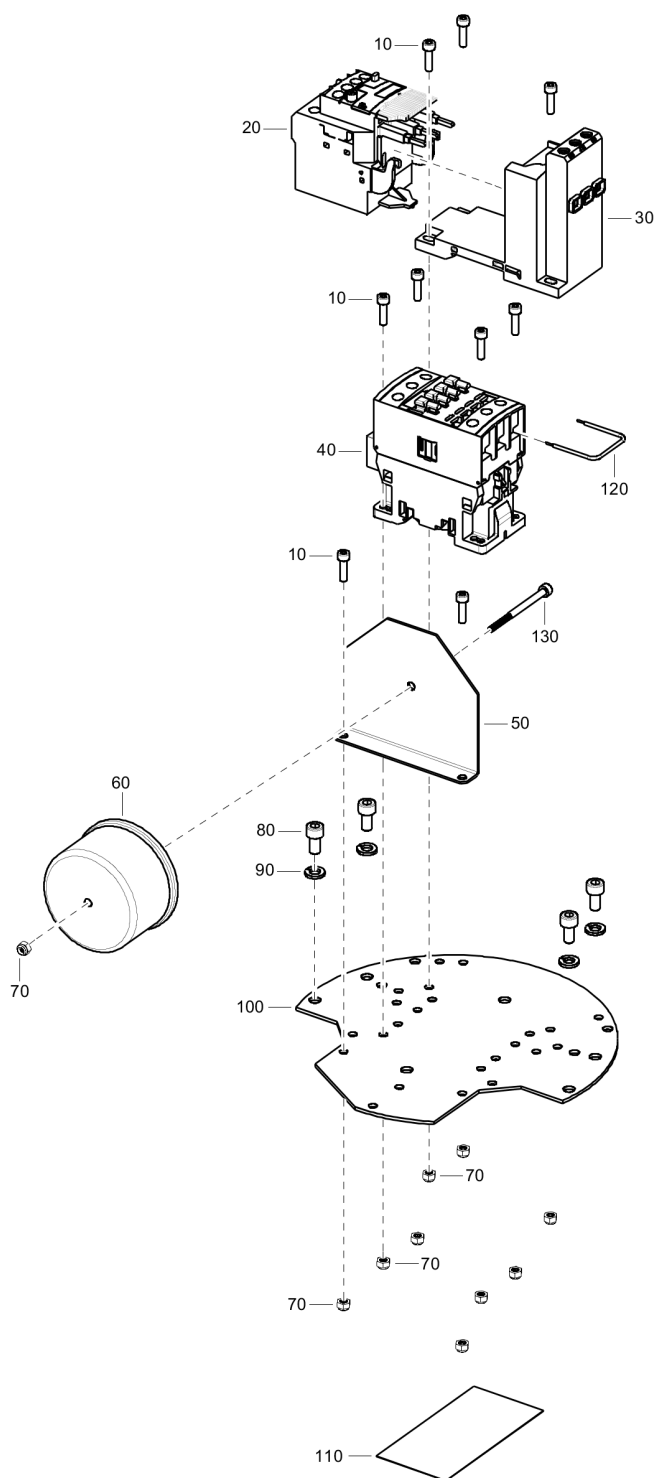


Refer to Parts Online for the most up to date information. The printed information might be outdated.

Fri Apr 24 06:38:48 UTC 2020

Item	Part No.	Name	Qty	L
10	1633010701	Screw DIN912 M4x15 A2-70 ISO 4762	9	
20	3081601937	Overload relay 20-24A	1	
30	3081601549	Mounting kit DB42 for TF42	1	
40	3081601755	Contactor AF26Z 100-250V	1	
50	3081601954	Bracket	1	
60	3081602077	Toroid trafo 30VA 3:1	1	
70	470W209785	Lock nut DIN 985 M4 A2	10	
80	4700W75654	Screw DIN912-M6x12-ISO:A2-70	4	
90	0333210837	Lock washer	4	
100	3081601953	Plate	1	
110	3081600594	Wiring diagram 6-lead Y & D connection	1	
120	470W367170	Wire CPL	3	
130	3081602082	Screw DIN 912 M4x55 8.8 A2	1	

Starter unit contactor Overload relay / toroid trafo 660-690V Y 50Hz

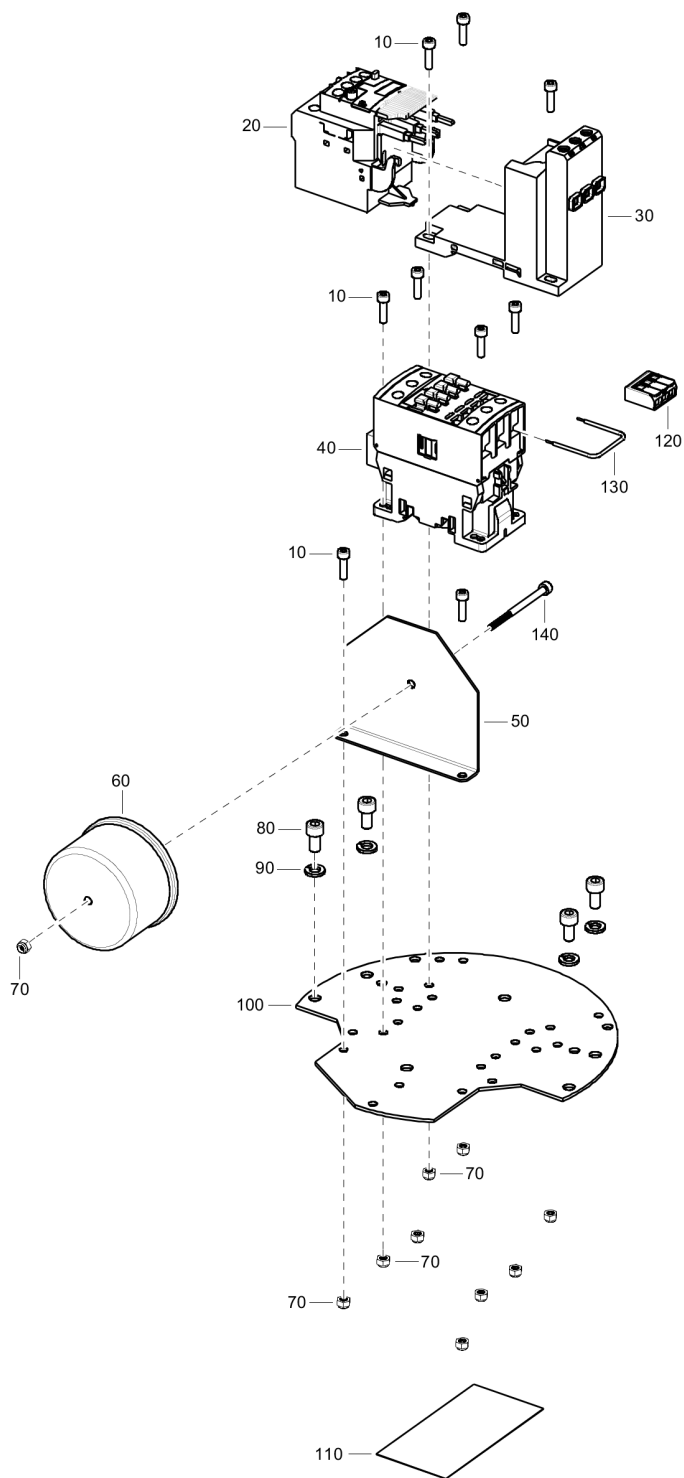


Refer to Parts Online for the most up to date information. The printed information might be outdated.

Fri Apr 24 06:38:49 UTC 2020

Item	Part No.	Name	Qty	L
10	1633010701	Screw DIN912 M4x15 A2-70 ISO 4762	9	
20	3081601938	Overload relay 13-16A	1	
30	3081601549	Mounting kit DB42 for TF42	1	
40	3081601755	Contactor AF26Z 100-250V	1	
50	3081601954	Bracket	1	
60	3081602077	Toroid trafo 30VA 3:1	1	
70	470W209785	Lock nut DIN 985 M4 A2	10	
80	4700W75654	Screw DIN912-M6x12-ISO:A2-70	4	
90	0333210837	Lock washer	4	
100	3081601953	Plate	1	
110	3081600594	Wiring diagram 6-lead Y & D connection	1	
120	3081602100	Connector	1	
130	470W367170	Wire CPL	3	
140	3081602082	Screw DIN 912 M4x55 8.8 A2	1	

Starter unit contactor control relay / overload relay 220-240V D 50Hz

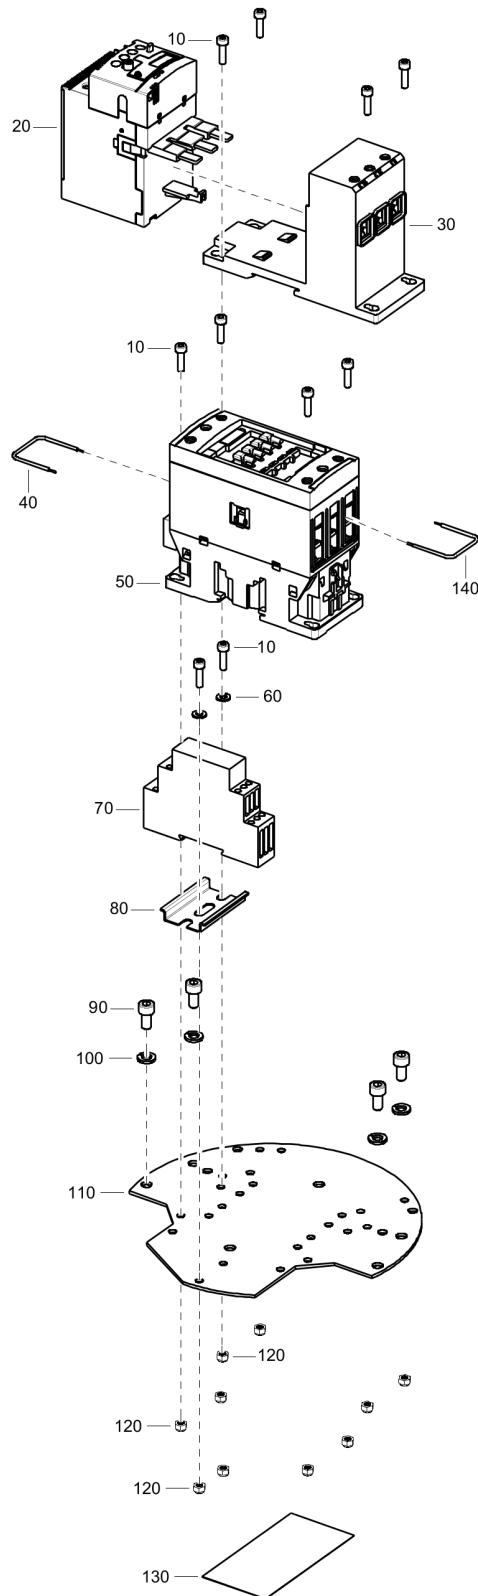


Refer to Parts Online for the most up to date information. The printed information might be outdated.

Fri Apr 24 06:38:49 UTC 2020

Item	Part No.	Name	Qty	L
10	1633010701	Screw DIN912 M4x15 A2-70 ISO 4762	10	
20	3081601429	Thermal overload relay 36-47A for AF40/52/65	1	
30	3081601550	Mounting kit DB65 for TF65	1	
40	470W743540	Wire CPL	4	
50	3081601426	Contactor AF52 100-250V 220-440V,53A,500V,45A,690V,35A	1	
60	1636000870	Washer DIN125	2	
70	3081600644	Control relay	1	
80	470W214871	Rail 35/7.5, 50mm	1	
90	3081600540	Screw DIN912 M6x20 A2-70	4	
100	0333210837	Lock washer	4	
110	3081601953	Plate	1	
120	470W209785	Lock nut DIN 985 M4 A2	10	
130	3081600594	Wiring diagram 6-lead Y & D connection	1	
140	3081601753	Wire CPL	3	

Starter unit contactor control relay / overload relay 380-400V D 50Hz

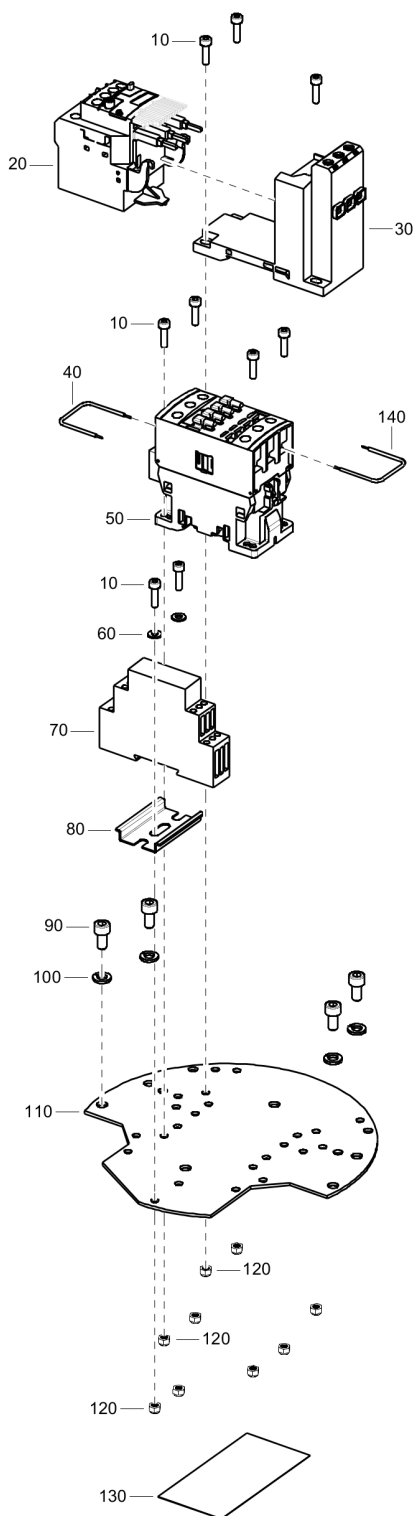


Refer to Parts Online for the most up to date information. The printed information might be outdated.

Fri Apr 24 06:38:50 UTC 2020

Item	Part No.	Name	Qty	L
10	1633010701	Screw DIN912 M4x15 A2-70 ISO 4762	9	
20	3081601555	Thermal overload relay 24-29A for AF09/16/26/38	1	
30	3081601549	Mounting kit DB42 for TF42	1	
40	470W743540	Wire CPL	4	
50	3081601756	Contactors AF30Z 100-250V 220-440V,32A,500V,28A,690V,21A	1	
60	1636000870	Washer DIN125	2	
70	3081600644	Control relay	1	
80	470W214871	Rail 35/7.5, 50mm	1	
90	3081600540	Screw DIN912 M6x20 A2-70	4	
100	0333210837	Lock washer	4	
110	3081601953	Plate	1	
120	470W209785	Lock nut DIN 985 M4 A2	9	
130	3081600594	Wiring diagram 6-lead Y & D connection	1	
140	3081601751	Wire CPL	3	

Starter unit contactor control relay / overload relay 415-440V D 50Hz

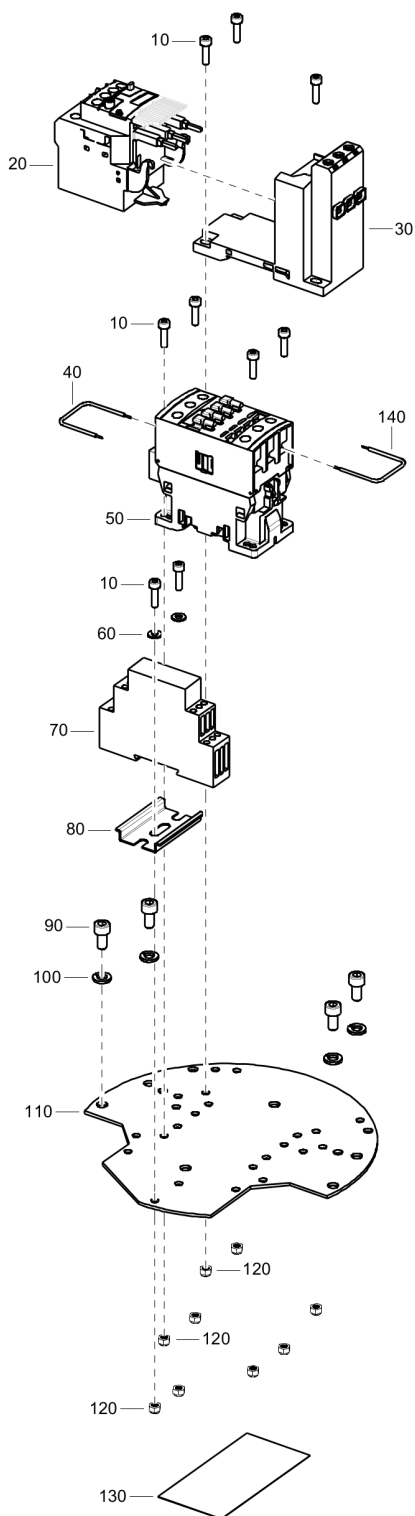


Refer to Parts Online for the most up to date information. The printed information might be outdated.

Fri Apr 24 06:38:50 UTC 2020

Item	Part No.	Name	Qty	L
10	1633010701	Screw DIN912 M4x15 A2-70 ISO 4762	9	
20	3081601555	Thermal overload relay 24-29A for AF09/16/26/38	1	
30	3081601549	Mounting kit DB42 for TF42	1	
40	470W743540	Wire CPL	4	
50	3081601756	Contactors AF30Z 100-250V 220-440V,32A,500V,28A,690V,21A	1	
60	1636000870	Washer DIN125	2	
70	3081600644	Control relay	1	
80	470W214871	Rail 35/7.5, 50mm	1	
90	3081600540	Screw DIN912 M6x20 A2-70	4	
100	0333210837	Lock washer	4	
110	3081601953	Plate	1	
120	470W209785	Lock nut DIN 985 M4 A2	9	
130	3081600594	Wiring diagram 6-lead Y & D connection	1	
140	3081601751	Wire CPL	3	

Starter units contactor control relay / overload relay toroid trafo 415-440V D 50Hz

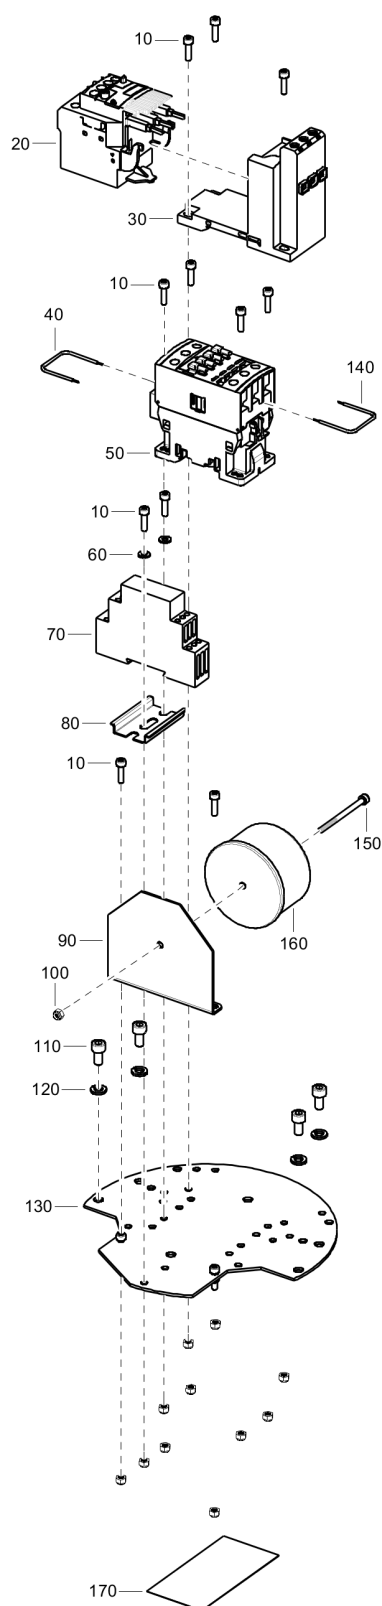


Refer to Parts Online for the most up to date information. The printed information might be outdated.

Fri Apr 24 06:38:51 UTC 2020

Item	Part No.	Name	Qty	L
10	1633010701	Screw DIN912 M4x15 A2-70 ISO 4762	11	
20	3081601555	Thermal overload relay 24-29A for AF09/16/26/38	1	
30	3081601549	Mounting kit DB42 for TF42	1	
40	470W743540	Wire CPL	4	
50	3081601755	Contacto AF26Z 100-250V	1	
60	1636000870	Washer DIN125	2	
70	3081600644	Control relay	1	
80	470W214871	Rail 35/7.5, 50mm	1	
90	3081601954	Bracket	1	
100	470W209785	Lock nut DIN 985 M4 A2	12	
110	3081600540	Screw DIN912 M6x20 A2-70	4	
120	0333210837	Lock washer	4	
130	3081601953	Plate	1	
140	3081601751	Wire CPL	3	
150	3081602082	Screw DIN 912 M4x55 8.8 A2	1	
160	3081602077	Toroid trafo 30VA 3:1	1	
170	3081600594	Wiring diagram 6-lead Y & D connection	1	

Starter unit contactor overload relay / toroid trafo 575-600V D 60Hz

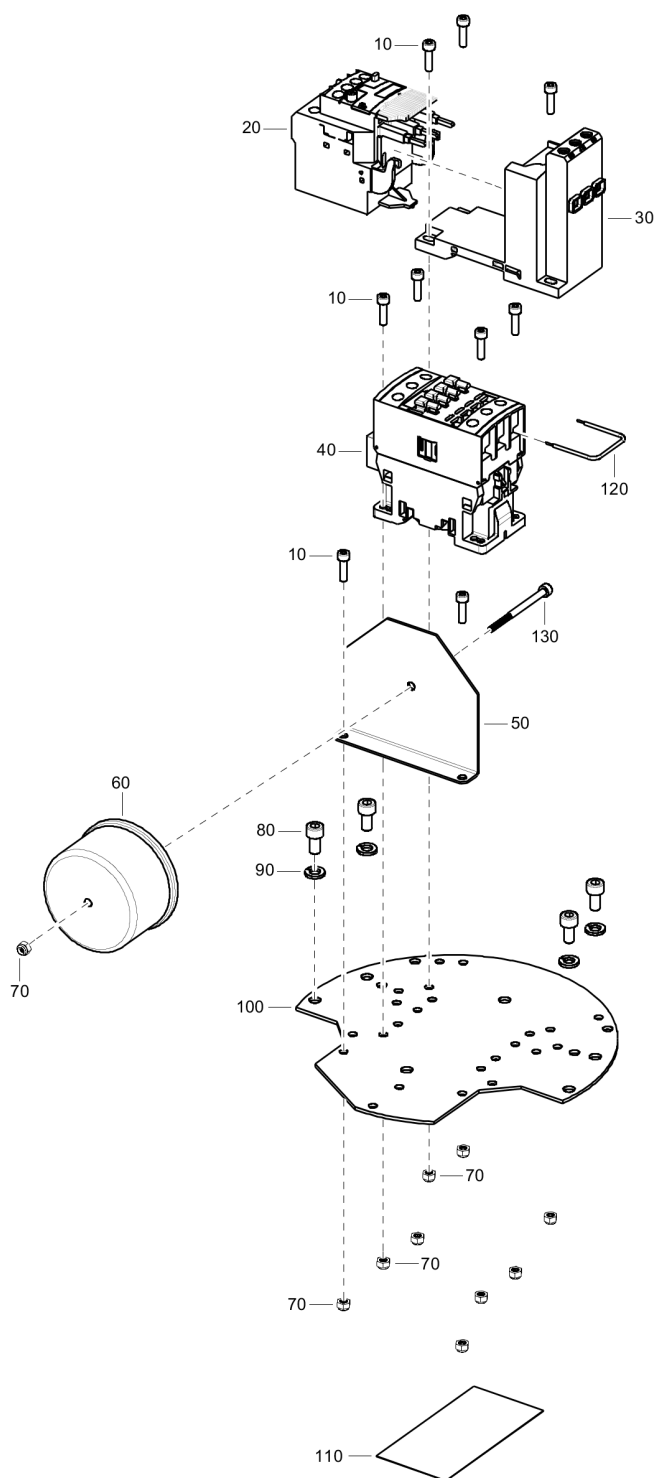


Refer to Parts Online for the most up to date information. The printed information might be outdated.

Fri Apr 24 06:38:52 UTC 2020

Item	Part No.	Name	Qty	L
10	1633010701	Screw DIN912 M4x15 A2-70 ISO 4762	9	
20	3081601937	Overload relay 20-24A	1	
30	3081601549	Mounting kit DB42 for TF42	1	
40	3081601755	Contactor AF26Z 100-250V	1	
50	3081601954	Bracket	1	
60	3081602077	Toroid trafo 30VA 3:1	1	
70	470W209785	Lock nut DIN 985 M4 A2	10	
80	4700W75654	Screw DIN912-M6x12-ISO:A2-70	4	
90	0333210837	Lock washer	4	
100	3081601953	Plate	1	
110	3081600594	Wiring diagram 6-lead Y & D connection	1	
120	470W367170	Wire CPL	3	
130	3081602082	Screw DIN 912 M4x55 8.8 A2	1	

Starter unit contactor control relay / overload relay 220-240V D 60Hz

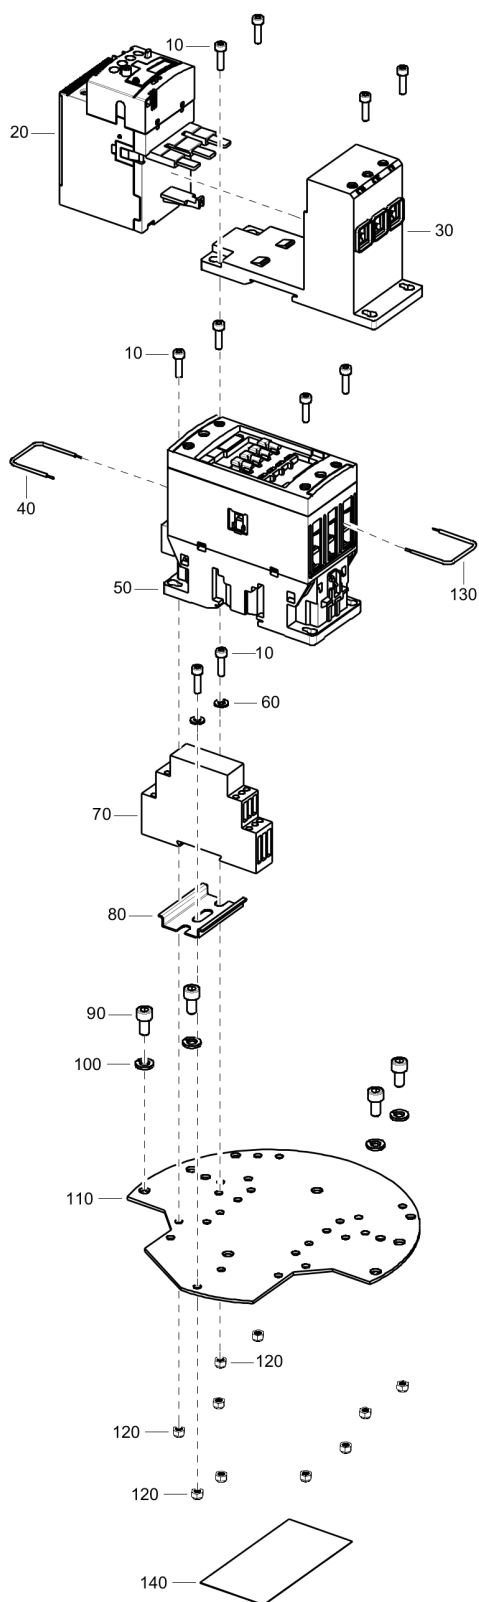


Refer to Parts Online for the most up to date information. The printed information might be outdated.

Fri Apr 24 06:38:52 UTC 2020

Item	Part No.	Name	Qty	L
10	1633010701	Screw DIN912 M4x15 A2-70 ISO 4762	10	
20	3081601430	Thermal overload relay 44-53A for AF40/52/65	1	
30	3081601550	Mounting kit DB65 for TF65	1	
40	470W743540	Wire CPL	4	
50	3081601426	Contactors AF52 100-250V 220-440V,53A,500V,45A,690V,35A	1	
60	1636000870	Washer DIN125	2	
70	3081600644	Control relay	1	
80	470W214871	Rail 35/7.5, 50mm	1	
90	3081600540	Screw DIN912 M6x20 A2-70	4	
100	0333210837	Lock washer	4	
110	3081601953	Plate	1	
120	470W209785	Lock nut DIN 985 M4 A2	10	
130	3081601753	Wire CPL	3	
140	3081600594	Wiring diagram 6-lead Y & D connection	1	

Starter unit contactor control relay / overload relay 380-400V Y 60Hz

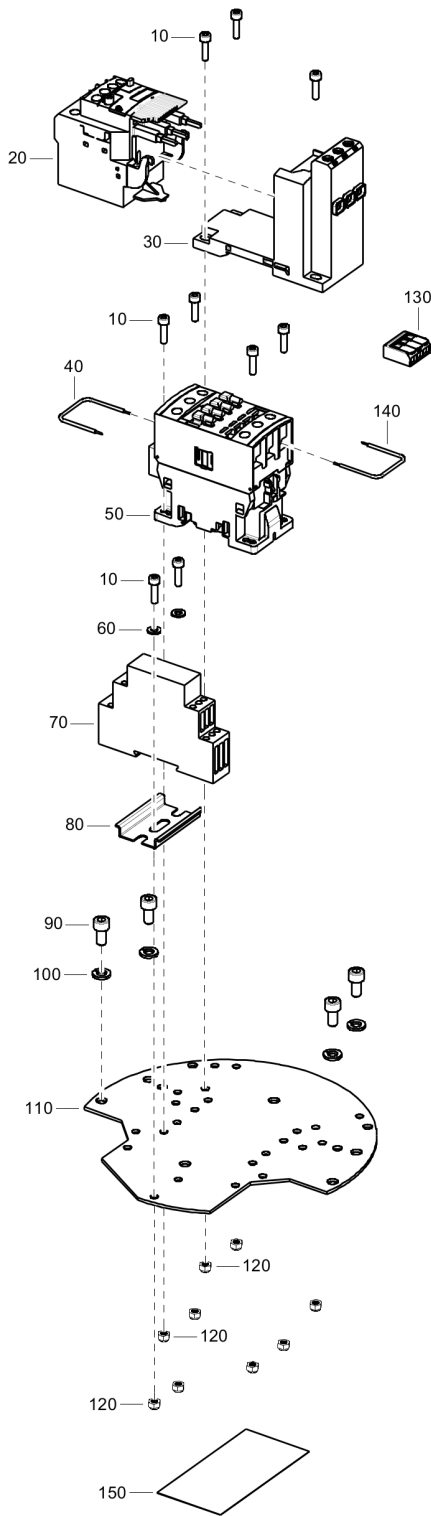


Refer to Parts Online for the most up to date information. The printed information might be outdated.

Fri Apr 24 06:38:53 UTC 2020

Item	Part No.	Name	Qty	L
10	1633010701	Screw DIN912 M4x15 A2-70 ISO 4762	9	
20	3081601554	Thermal overload relay 29-35A for AF09/16/26/38	1	
30	3081601549	Mounting kit DB42 for TF42	1	
40	470W743540	Wire CPL	4	
50	3081601756	Contactor AF30Z 100-250V 220-440V,32A,500V,28A,690V,21A	1	
60	1636000870	Washer DIN125	2	
70	3081600644	Control relay	1	
80	470W214871	Rail 35/7.5, 50mm	1	
90	3081600540	Screw DIN912 M6x20 A2-70	4	
100	0333210837	Lock washer	4	
110	3081601953	Plate	1	
120	470W209785	Lock nut DIN 985 M4 A2	9	
130	3081602100	Connector	1	
140	3081601751	Wire CPL	1	
150	3081600594	Wiring diagram 6-lead Y & D connection	1	

Starter unit contactor control relay / overload relay 440-480V D 60Hz

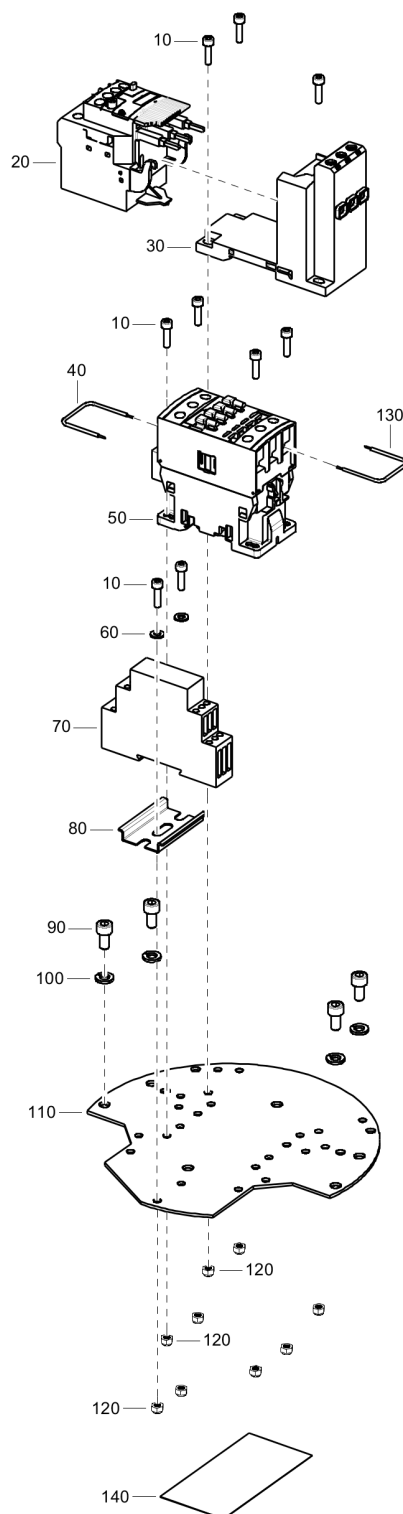


Refer to Parts Online for the most up to date information. The printed information might be outdated.

Fri Apr 24 06:38:53 UTC 2020

Item	Part No.	Name	Qty	L
10	1633010701	Screw DIN912 M4x15 A2-70 ISO 4762	9	
20	3081601555	Thermal overload relay 24-29A for AF09/16/26/38	1	
30	3081601549	Mounting kit DB42 for TF42	1	
40	470W743540	Wire CPL	4	
50	3081601756	Contactor AF30Z 100-250V 220-440V,32A,500V,28A,690V,21A	1	
60	1636000870	Washer DIN125	2	
70	3081600644	Control relay	1	
80	470W214871	Rail 35/7.5, 50mm	1	
90	3081600540	Screw DIN912 M6x20 A2-70	4	
100	0333210837	Lock washer	4	
110	3081601953	Plate	1	
120	470W209785	Lock nut DIN 985 M4 A2	9	
130	3081601751	Wire CPL	3	
140	3081600594	Wiring diagram 6-lead Y & D connection	1	

Starter units contactor control relay / overload relay toroid trafo 440-480V D 60Hz

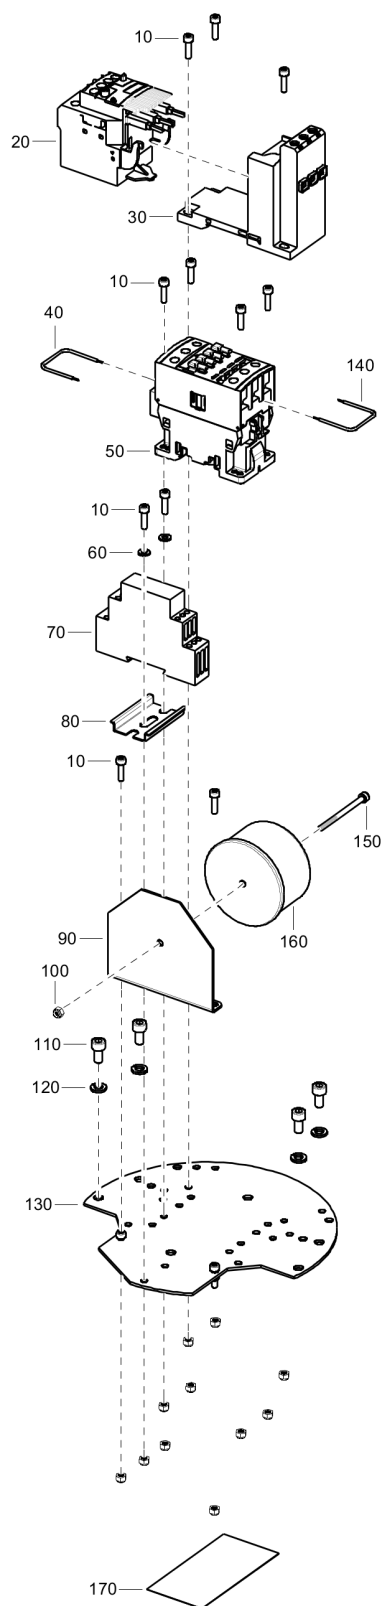


Refer to Parts Online for the most up to date information. The printed information might be outdated.

Fri Apr 24 06:38:54 UTC 2020


Item	Part No.	Name	Qty	L
10	1633010701	Screw DIN912 M4x15 A2-70 ISO 4762	11	
20	3081601555	Thermal overload relay 24-29A for AF09/16/26/38	1	
30	3081601549	Mounting kit DB42 for TF42	1	
40	470W743540	Wire CPL	4	
50	3081601755	Contacto AF26Z 100-250V	1	
60	1636000870	Washer DIN125	2	
70	3081600644	Control relay	1	
80	470W214871	Rail 35/7.5, 50mm	1	
90	3081601954	Bracket	1	
100	470W209785	Lock nut DIN 985 M4 A2	12	
110	3081600540	Screw DIN912 M6x20 A2-70	4	
120	0333210837	Lock washer	4	
130	3081601953	Plate	1	
140	3081601751	Wire CPL	3	
150	3081602082	Screw DIN 912 M4x55 8.8 A2	1	
160	3081602077	Toroid trafo 30VA 3:1	1	
170	3081600594	Wiring diagram 6-lead Y & D connection	1	

Motor unit

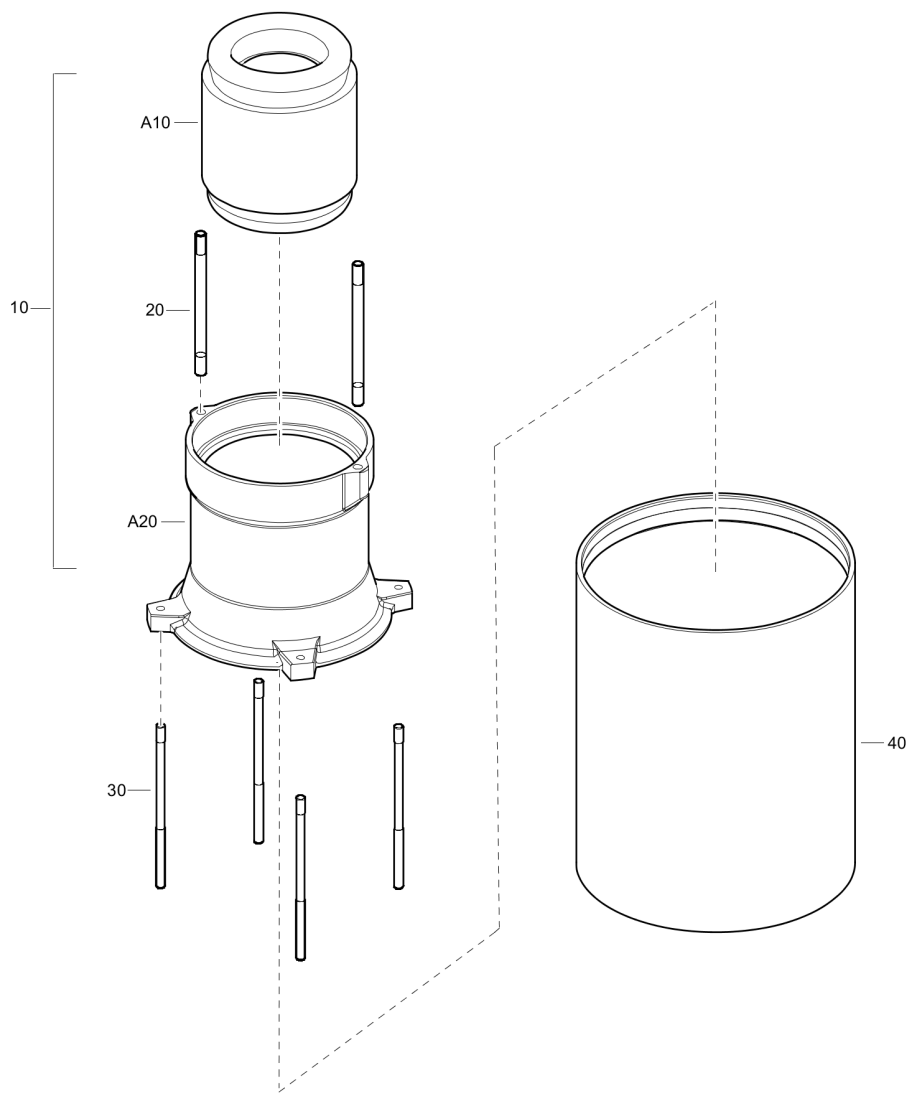


Item	Part No.	Name	Qty	L
10	-	Stator unit kit WEDA D70	-	
-	3081690700	Stator unit kit WEDA D70 230VD,400VY 50Hz , 460VY 60 Hz	1	
-	3081690701	Stator unit kit WEDA D70 400VD,690VY 50Hz, 460VD 60Hz	1	
-	3081690702	Stator unit kit WEDA D70 500VD 50Hz , 575-600VD 60Hz	1	
-	3081690703	Stator unit kit WEDA D70 220-240VD, 380-400VY 60Hz	1	
-	3081690704	Stator unit kit WEDA D70 415-440VD 50Hz	1	
-	3081690705	Stator unit kit WEDA D70 230VD//,380VY//,460VDSer 60Hz	1	
-	3081690706	Stator unit kit WEDA D70 380-400VD, 690VY 60Hz	1	
A10	-	Stator WEDA D70	-	
-	470W724044	Stator WEDA D70 230VD,400VY 50Hz , 460VY 60 Hz	1	
-	470W724013	Stator WEDA D70 400VD,690VY 50Hz, 460VD 60Hz	1	
-	470W724017	Stator WEDA D70 500VD 50Hz , 575-600VD 60Hz	1	
-	470W724045	Stator WEDA D70 220-240VD, 380-400VY 60Hz	1	
-	470W724046	Stator WEDA D70 415-440VD 50Hz	1	
-	3081601290	Stator WEDA D70	1	
-	3081601304	Stator WEDA D70	1	
-	3081601465	Stator WEDA D70	1	
-	3081601518	Stator WEDA D70 230VD//,380VY//,460VDSer 60Hz	1	
-	3081601552	Stator WEDA D70 380-400VD, 690VY 60Hz	1	
A20	470W724016	Stator housing	1	
20	470W274055	Stud	2	
30	470W273045	Stud	4	
40	470W271012	Outer casing	1	

Shaft unit

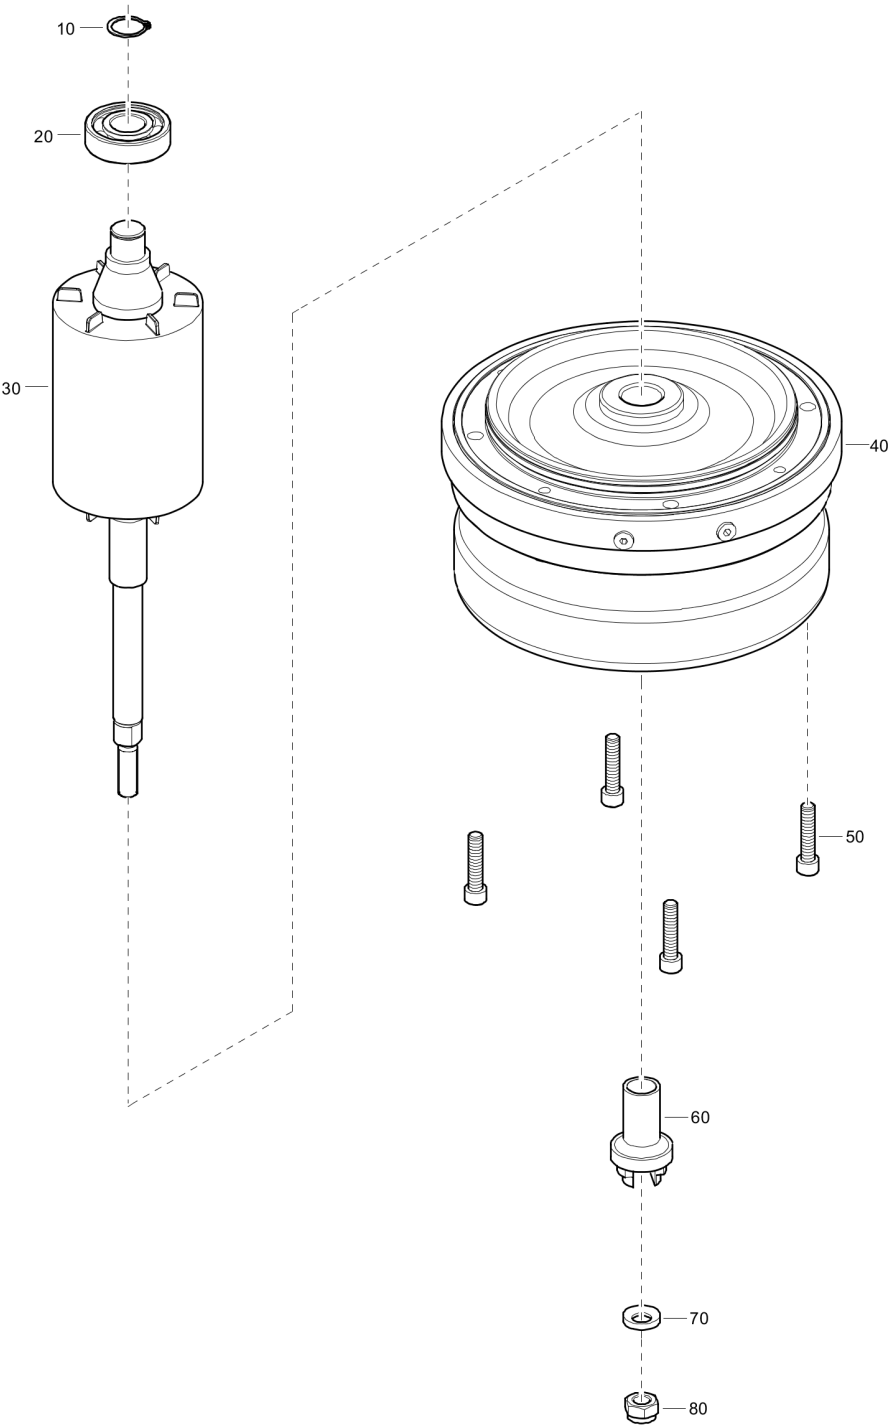

Item	Part No.	Name	Qty	L
10	4700W50521	Circlip	1	
20	3081601488	Ball bearing	1	
30	1605264100	Rotor WEDA D70	1	
40	470W272041	Seal unit kit WEDA D70	1	
50	4700W75695	Screw	4	
60	470W274106	Driving sleeve	1	
70	470W274108	Washer	1	
80	1633010875	Lock nut DIN 985 M14 A2	1	

Seal unit

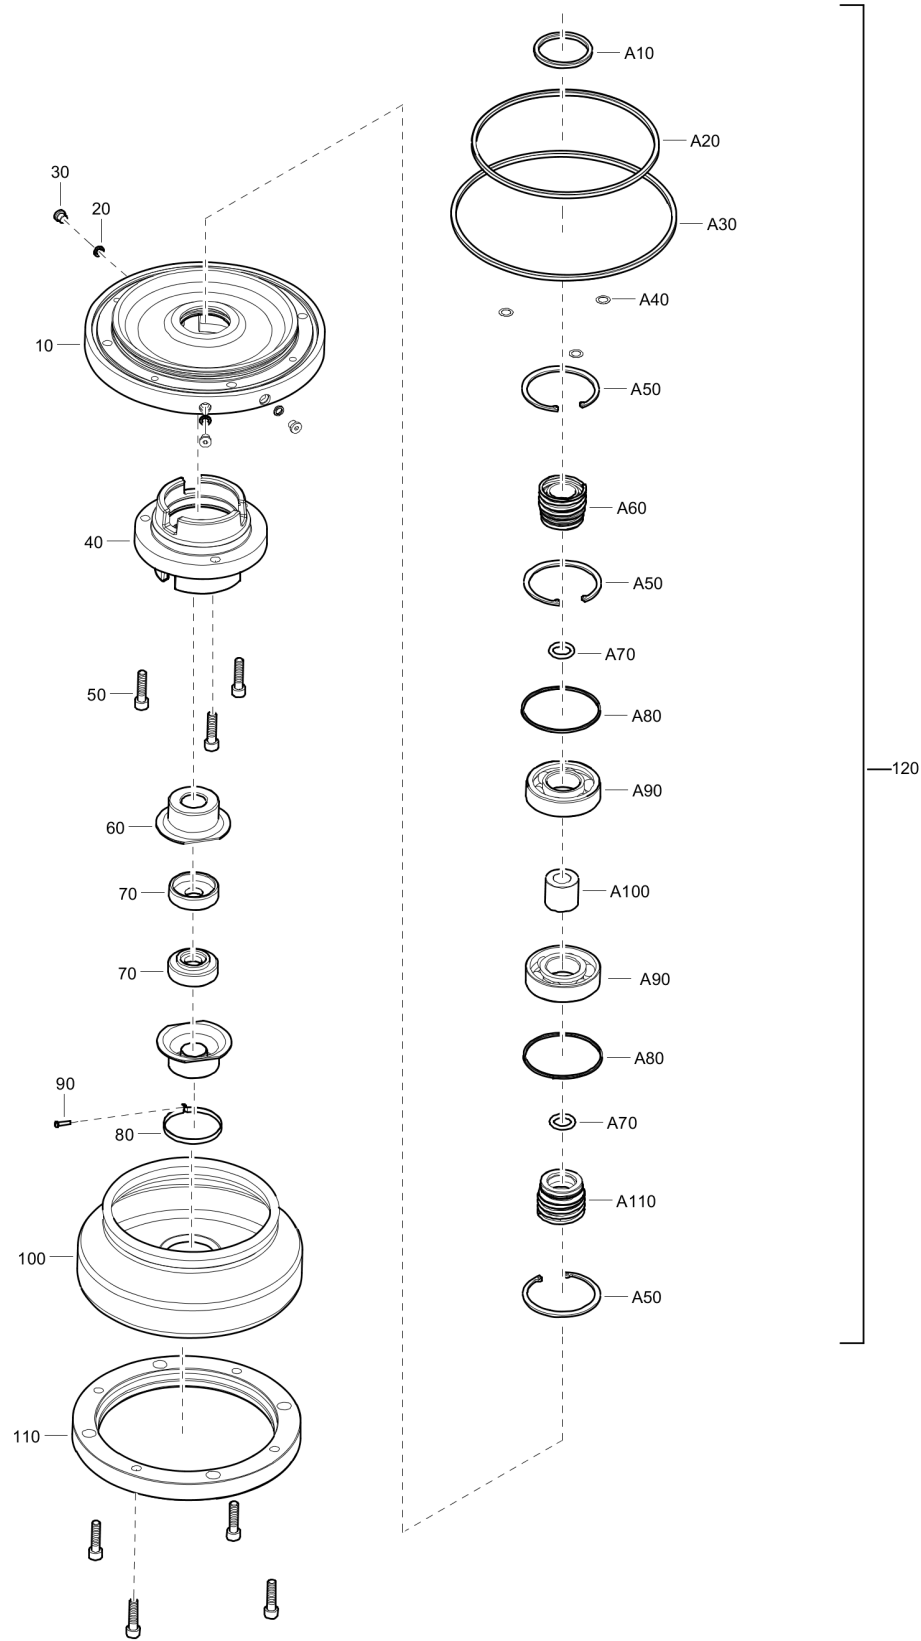


Refer to Parts Online for the most up to date information. The printed information might be outdated.

Fri Apr 24 06:38:55 UTC 2020

Item	Part No.	Name	Qty	L
10	470W271014	Bearing bracket	1	
20	4700W65006	O-ring 8,3X2,4-NBR 70 shore	3	
30	470W254042	Screw plug DIN908 M10X1 A2	3	
40	470W273033	Bearing housing WEDA D70	1	
50	4700W75694	Screw DIN912-M10X40-ISO:A2-70	7	
60	470W274050	Seal holder	1	
70	470W274052	Holder	2	
80	470W274231	Clamp	1	
90	1633010741	Screw DIN 84 M4x15 A2 ISO 1207	1	
100	470W271023	Oil bag	1	
110	470W272028	Ring for oil bag ring 75500124	1	
120	3081690355	Repair kit seal unit WEDA D70	1	
A10	470W274062	O-ring 62,2X5,7-NBR 70 shore	1	
A20	4700W65131	O-ring 209,3X5,7-NBR 70 shore	1	
A30	4700W65136	O-ring 259,3X5,7-NBR 70 shore	1	
A40	470W274156	Washer seeger DIN988 PS11X17X1	3	
A50	4700W50671	Circlip DIN472-90X3	3	
A60	4812050216	Upperseal	1	
A70	470W274086	O-ring 22X5-NBR 70 shore	2	
A80	4700W65108	O-ring 89,5X3-NBR 70 shore	2	
A90	470W274048	Ball bearing	2	
A100	470W274047	Bearing bushing	1	
A110	4812050215	Lower seal	1	

Wet end unit WEDA D70H 50/60 Hz

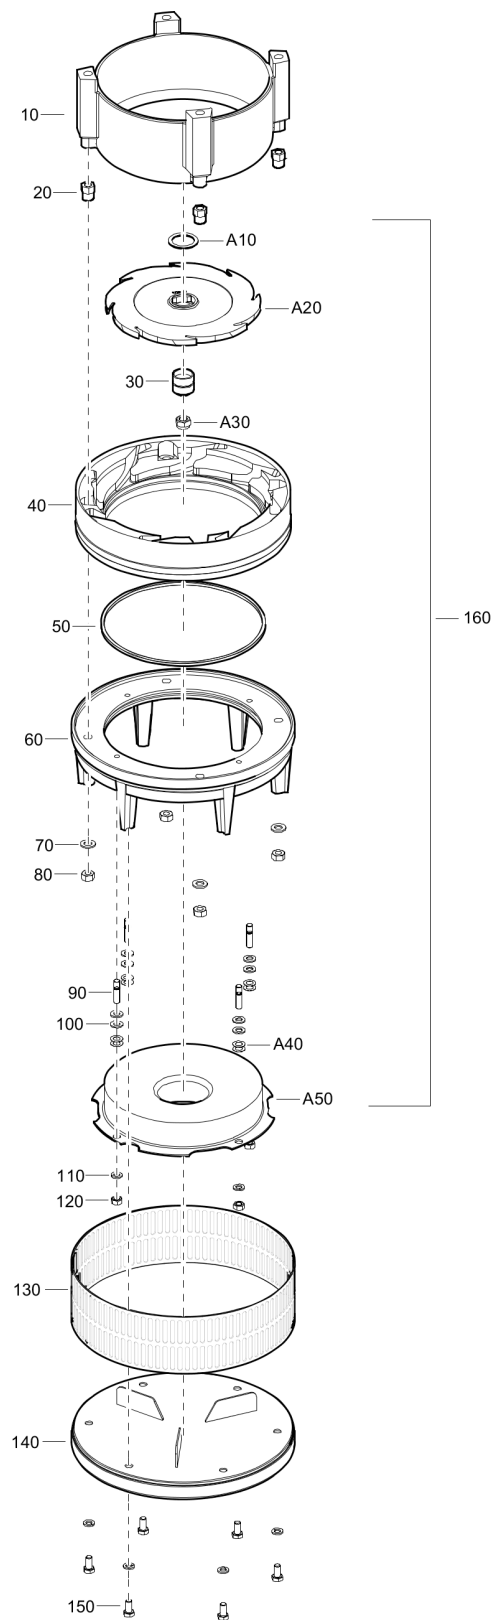


Refer to Parts Online for the most up to date information. The printed information might be outdated.

Fri Apr 24 06:38:56 UTC 2020

Item	Part No.	Name	Qty	L
10	470W271021	Wear plate	1	
20	470W274409	Nut	4	
30	470W274107	Protective housing	1	
40	470W271018	Diffuser WEDA D70H	1	
50	4700W65136	O-ring 259,3X5,7-NBR 70 shore	1	
60	470W271020	Diffuser holder	1	
70	300012933	Washer DIN 125 Ø13 A2	4	
80	1633010722	Nut DIN 934 M12 A2	4	
90	4700W69636	Stud DIN939-M10X28-ISO:A2-70	4	
100	300012932	Washer DIN 125	12	
110	333217411	Lock washer DIN 127	10	
120	5541062500	Nut DIN 934	4	
130	470W272029	Strainer	1	
140	470W271015	Bottom plate	1	
150	147196465	Screw DIN 933	6	
160	-	Wear parts kit WEDA D70H	-	
-	3081690361	Wear parts kit WEDA D70H 50Hz	1	
-	3081690362	Wear parts kit WEDA D70H 60Hz	1	
A10	470W274109	Trimming spacer	12	
A20	-	Impeller WEDA D70H	-	
-	470W272135	Impeller WEDA D70H 60Hz	1	
-	470W272032	Impeller WEDA D70H 50Hz	1	
A30	1633010875	Lock nut DIN 985 M14 A2	1	
A40	470W214194	Trimming spacer	28	
A50	470W271026	Diffuser center WEDA D70H	1	

Wet end unit WEDA D70L 50/60 Hz

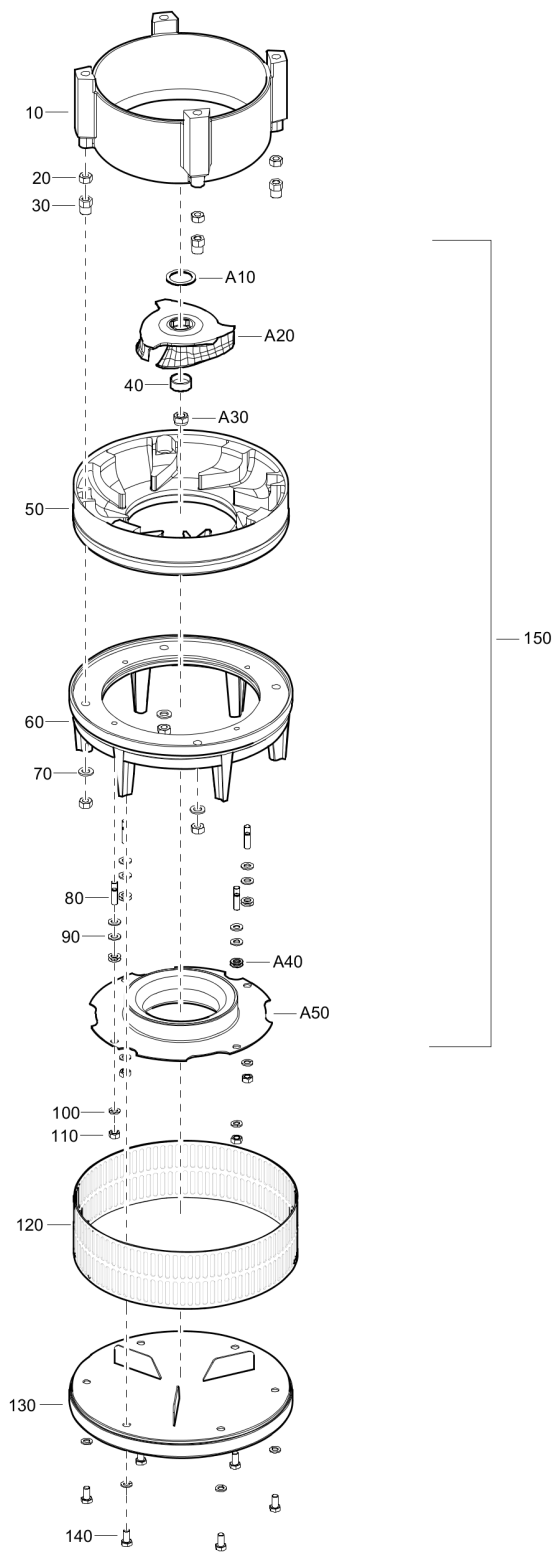


Refer to Parts Online for the most up to date information. The printed information might be outdated.

Fri Apr 24 06:38:57 UTC 2020


Item	Part No.	Name	Qty	L
10	470W271021	Wear plate	1	
20	1633010722	Nut DIN 934 M12 A2	8	
30	470W274409	Nut	4	
40	470W274107	Protective housing	1	
50	470W271016	Diffuser WEDA D70L	1	
60	470W271020	Diffuser holder	1	
70	0300012933	Plain washer	4	
80	4700W69636	Stud DIN939-M10X28-ISO:A2-70	4	
90	0300012932	Washer	12	
100	0333217411	Lock washer DIN 127	10	
110	5541062500	Nut DIN 934	4	
120	470W272029	Strainer	1	
130	470W271015	Bottom plate	1	
140	0147196465	Screw DIN 933	6	
150	-	Wear parts kit WEDA D70L	-	
-	3081690359	Wear parts kit WEDA D70L 50Hz	1	
-	3081690360	Wear parts kit WEDA D70L 60Hz	1	
A10	470W274109	Trimming spacer	12	
A20	-	Impeller WEDA D70L	-	
-	47W272031H	Impeller WEDA D70L 50Hz	1	
-	470W272134	Impeller WEDA D70L 60HZ	1	
A30	1633010875	Lock nut DIN 985 M14 A2	1	
A40	470W214194	Trimming spacer	28	
A50	DW271024CN	Diffuser center WEDA D70L	1	

Discharge unit 6-4" HOSE

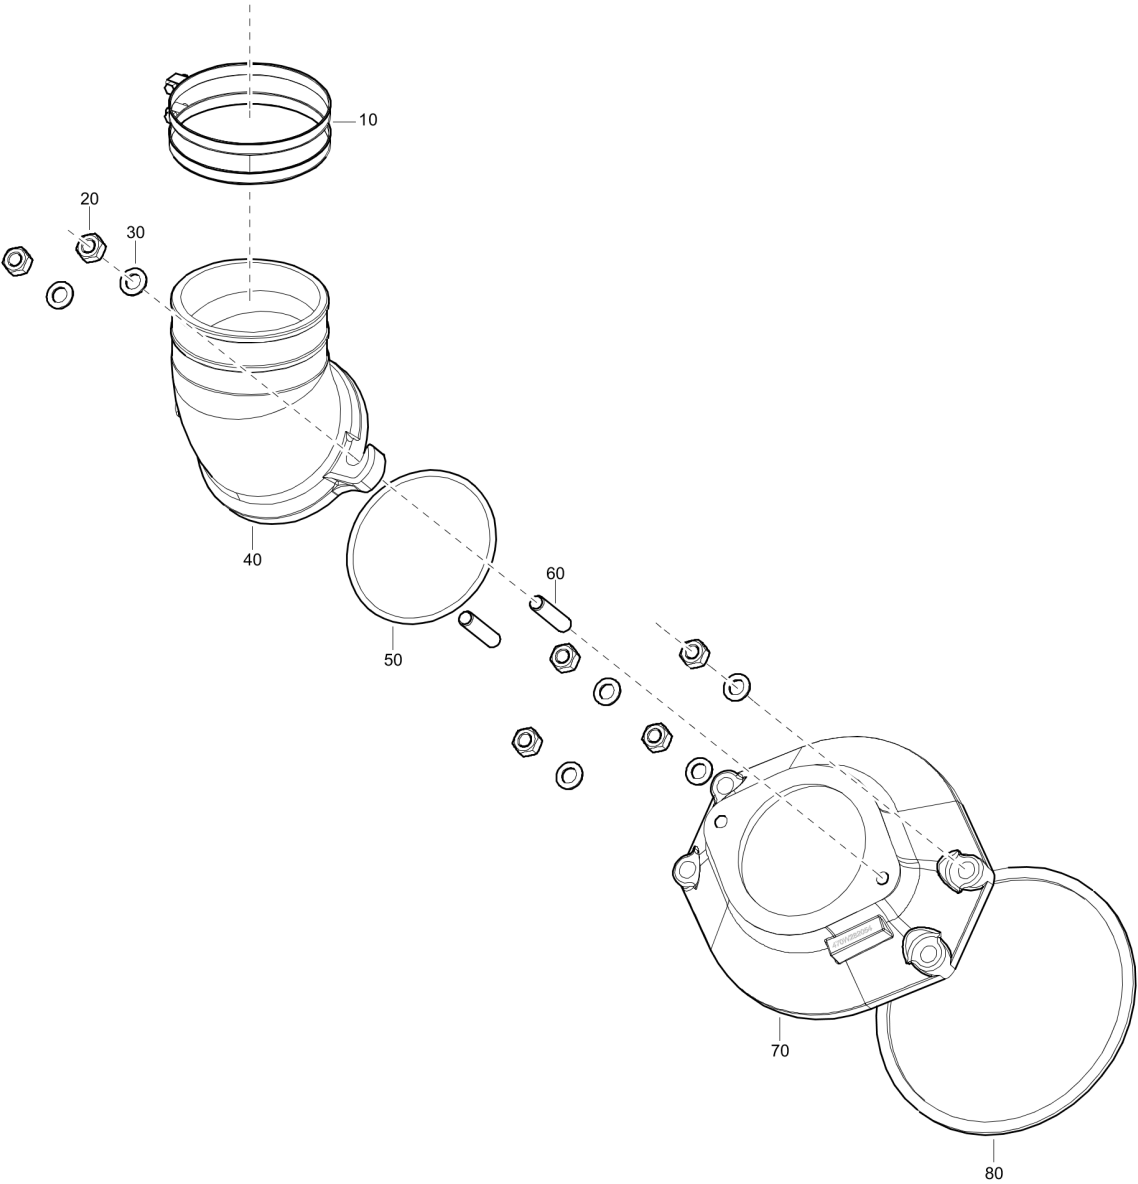


Item	Part No.	Name	Qty	L
10	4700W58023	Clamp	2	
20	5541062500	Nut DIN 934	6	
30	4700W51170	Washer DIN433-10,5-140HV-A2	6	
40	470W202565	Discharge 4" hose	1	
50	0663212097	O-ring 95X4 NBR 70 shore	1	
60	4700W69642	Stud DIN938-M10x35-ISO:A2-70	2	
70	470W282054	Jointing bracket	1	
80	470W284058	Gasket for discharge 6"	1	

Discharge unit 6-4" BSP/NPT

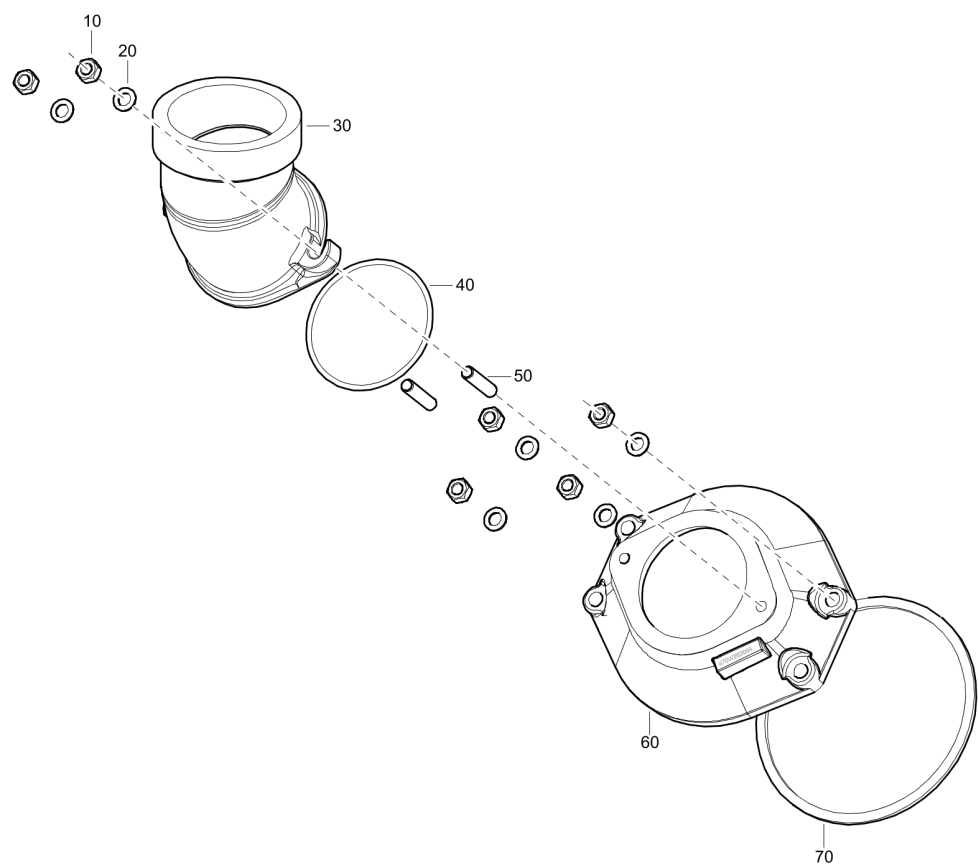


Item	Part No.	Name	Qty	L
10	5541062500	Nut DIN 934	6	
20	4700W51170	Washer DIN433-10,5-140HV-A2	6	
30	-	Discharge	-	
-	470W202481	Discharge ISO-G4	1	
-	470W202573	Discharge 4" NPT	1	
40	0663212097	O-ring 95X4 NBR 70 shore	1	
50	4700W69642	Stud DIN938-M10x35-ISO:A2-70	2	
60	470W282054	Jointing bracket	1	
70	470W284058	Gasket for discharge 6"	1	

Discharge unit 6-6" BSP/NPT

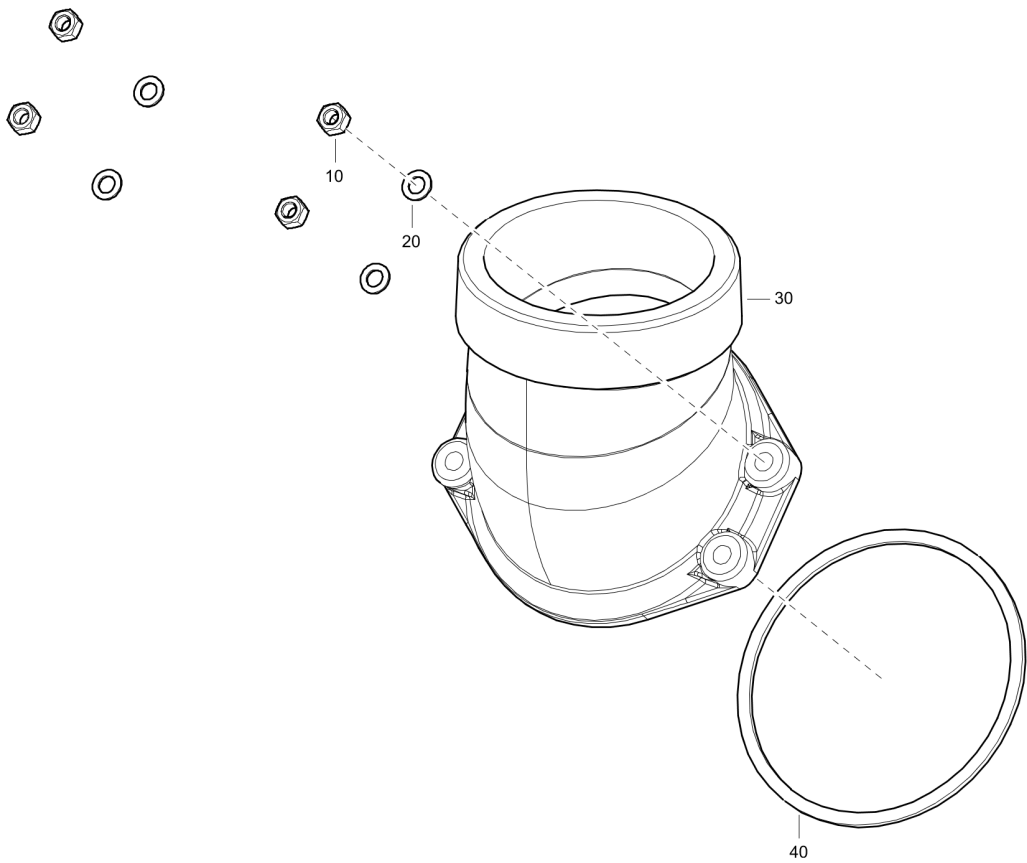


Item	Part No.	Name	Qty	L
10	5541062500	Nut DIN 934	4	
20	4700W51170	Washer DIN433-10,5-140HV-A2	4	
30	-	Discharge	-	
-	470W282169	Discharge 6" NPT	1	
-	470W282177	Discharge ISO G6	1	
40	470W284058	Gasket for discharge 6"	1	

Discharge unit 6-6" HOSE

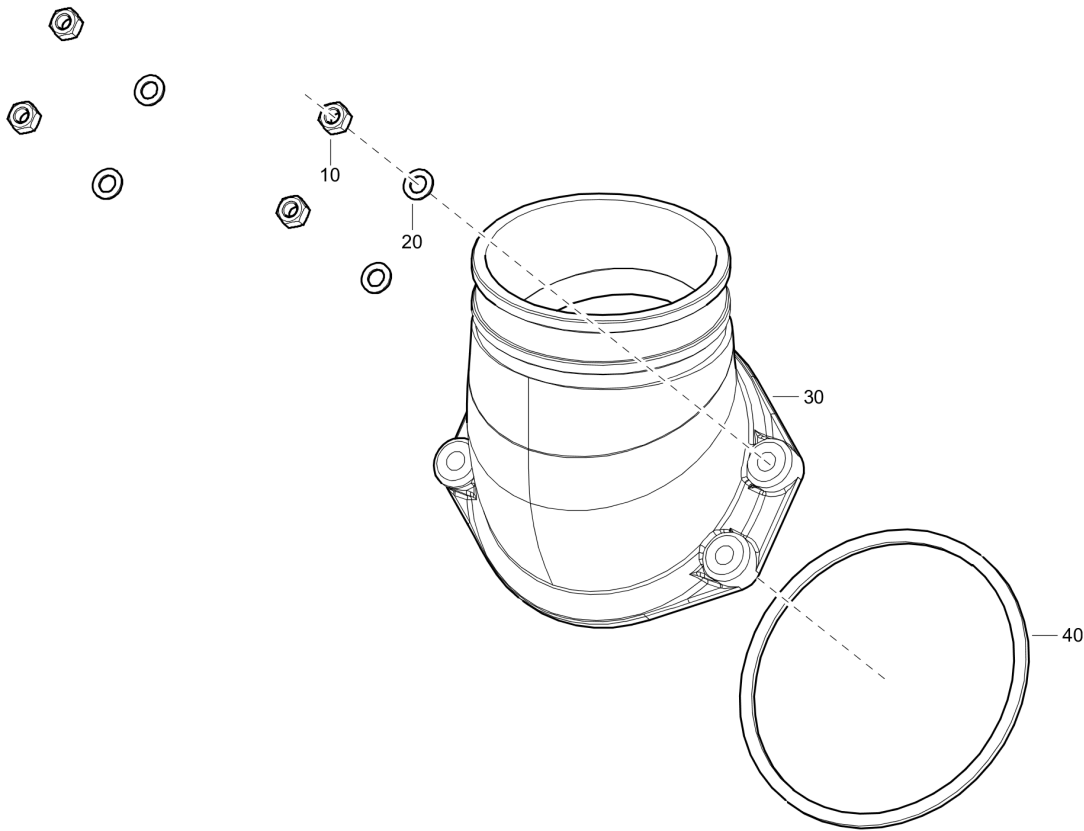


Item	Part No.	Name	Qty	L
10	1633010722	Nut DIN 934 M12 A2	4	
20	0300012933	Plain washer	4	
30	-	Discharge	-	
-	3081600976	Discharge 4" hose	1	
-	3081601107	Discharge 6" hose	1	
40	3081601281	O-ring 170,82X5,33 NBR 70 shore	1	

Cable unit 4G2,5

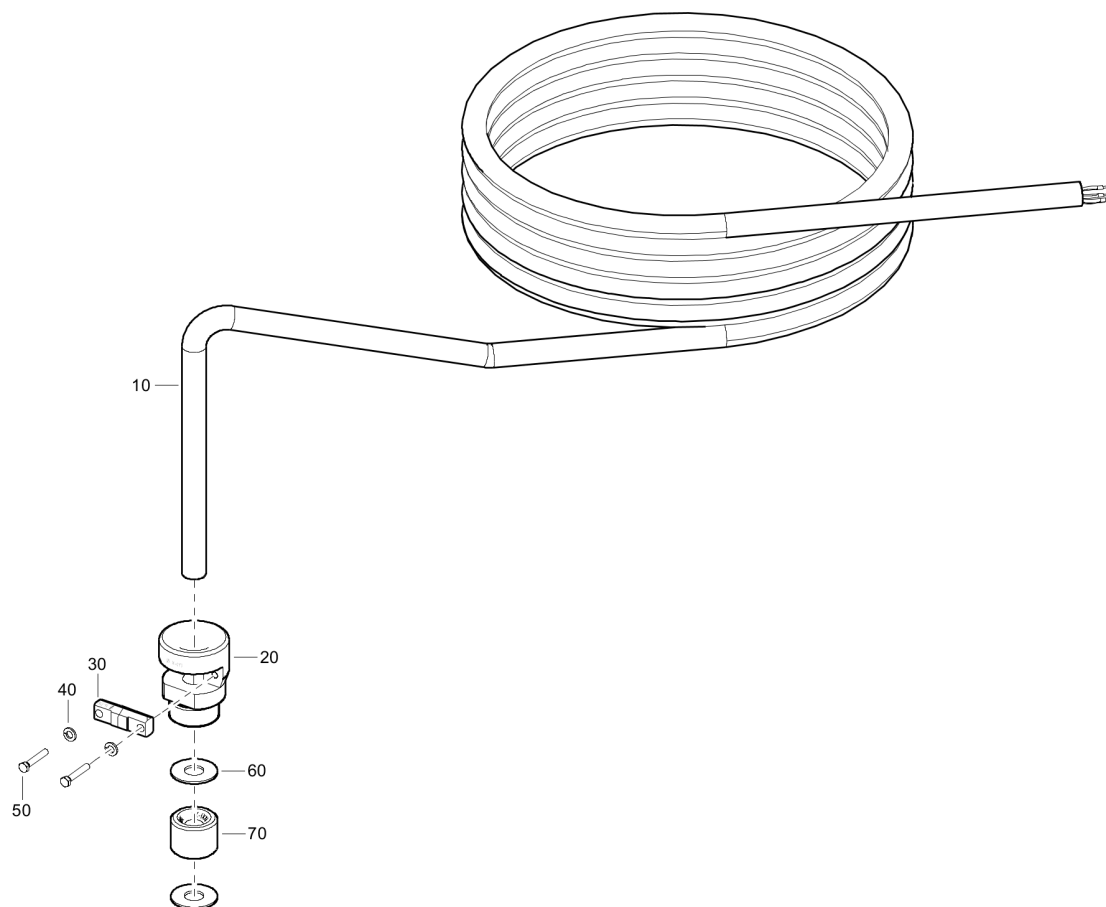


Item	Part No.	Name	Qty	L
10	1603490300	Cable kit 4G2,5mm ² 20m Ø12,1-13,5 mm	1	
20	3081600576	Cable inlet G1 1/4" cable Ø12-(18) mm	1	
30	3081600579	Strain relief for cable Ø12-(16) mm	1	
40	3081600585	Washer for cable Ø12-(14) mm	2	
50	4700W76290	Screw DIN933-M6x30-ISO:A2-70	2	
60	0333210837	Lock washer	2	
70	3081600519	Cable seal cable Ø12-(14) mm	1	

Cable unit 4G4

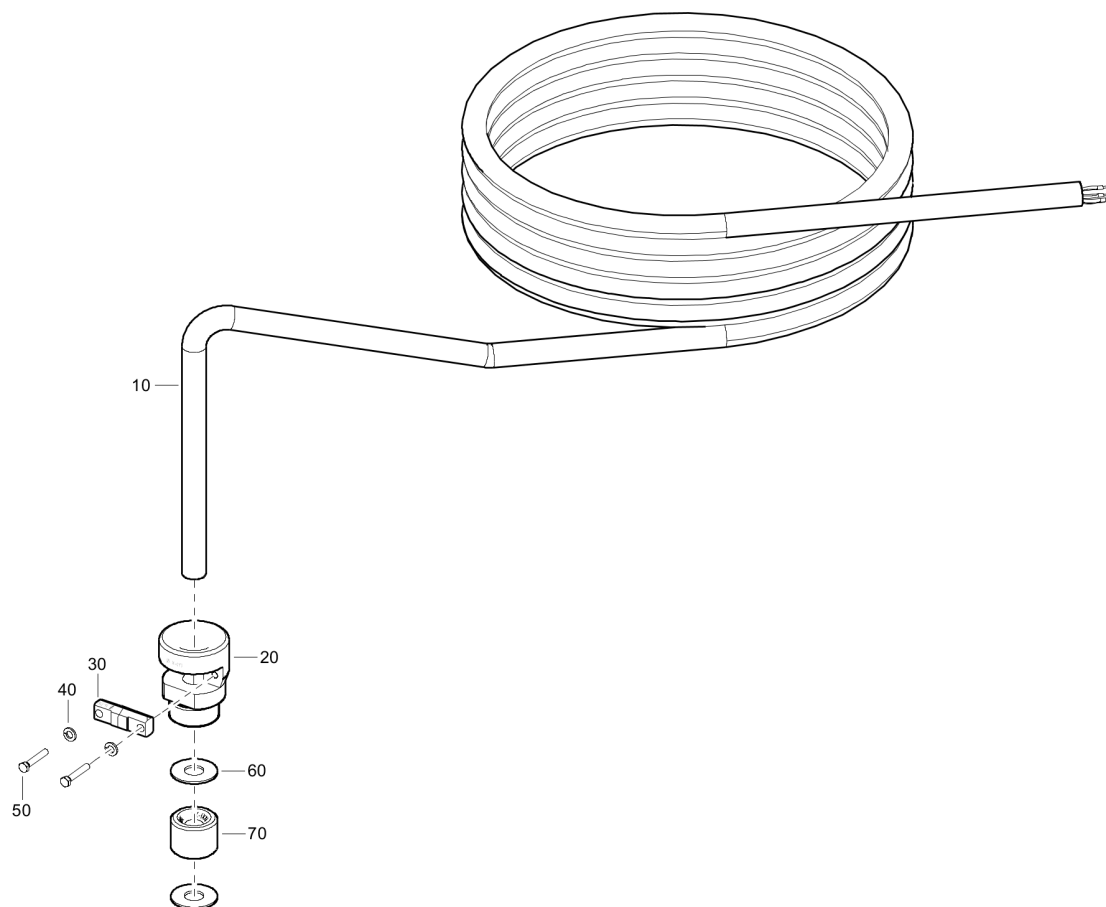


Item	Part No.	Name	Qty	L
10	1605227000	Cable kit 4G4mm² 20m Ø14,4-15,4 mm	1	
20	3081600576	Cable inlet G1 1/4" cable Ø12-(18) mm	1	
30	3081600579	Strain relief for cable Ø12-(16) mm	1	
40	3081600586	Washer for cable Ø14-(16) mm	2	
50	4700W76290	Screw DIN933-M6x30-ISO:A2-70	2	
60	0333210837	Lock washer	2	
70	3081600520	Cable seal cable Ø14-(16) mm	1	

Cable unit 4G6

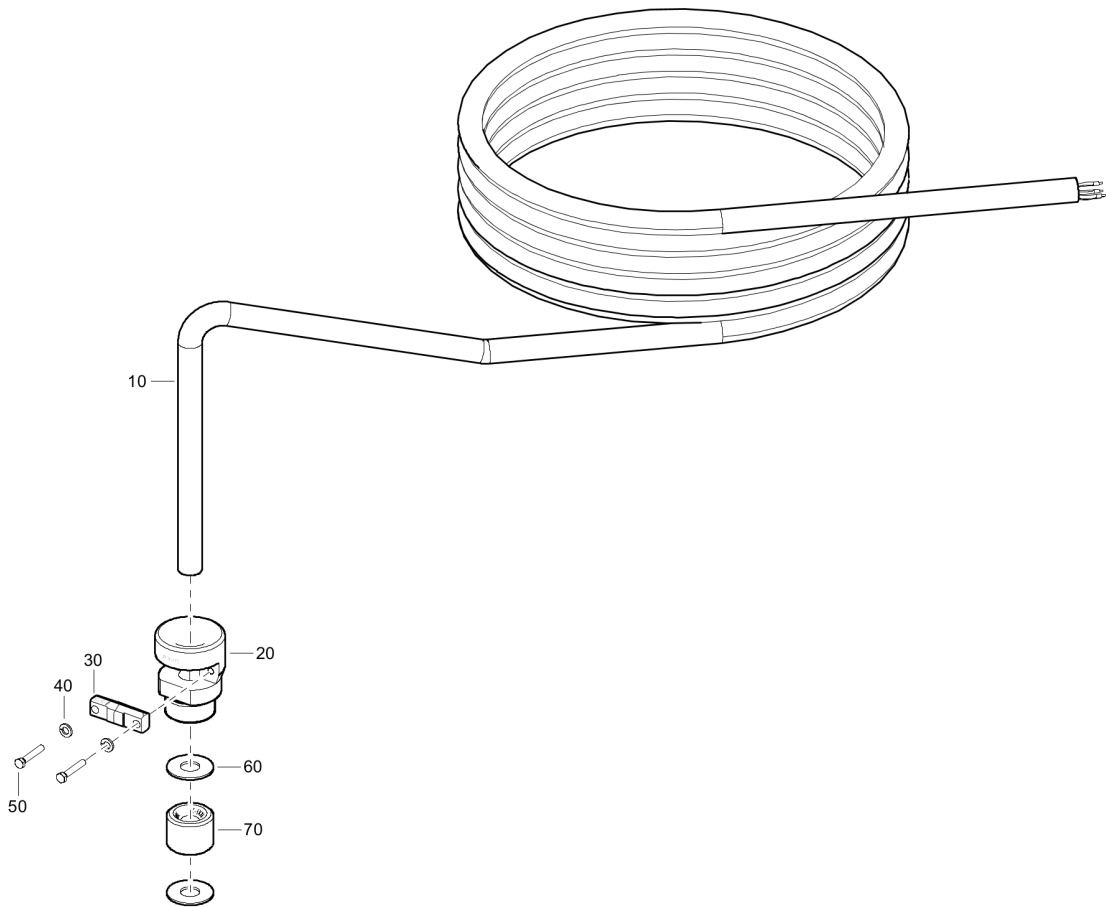

Item	Part No.	Name	Qty	L
10	3081601405	Cable 4G6mm² 20m Ø15,7-17,4 mm	1	
20	3081600576	Cable inlet G1 1/4" cable Ø12-(18) mm	1	
30	3081600580	Strain relief for cable Ø16-(26) mm	1	
40	3081600587	Washer for cable Ø16-(18) mm	2	
50	4700W76290	Screw DIN933-M6x30-ISO:A2-70	2	
60	0333210837	Lock washer	2	
70	3081600521	Cable seal cable Ø16-(18) mm	1	

Cable unit 4G10

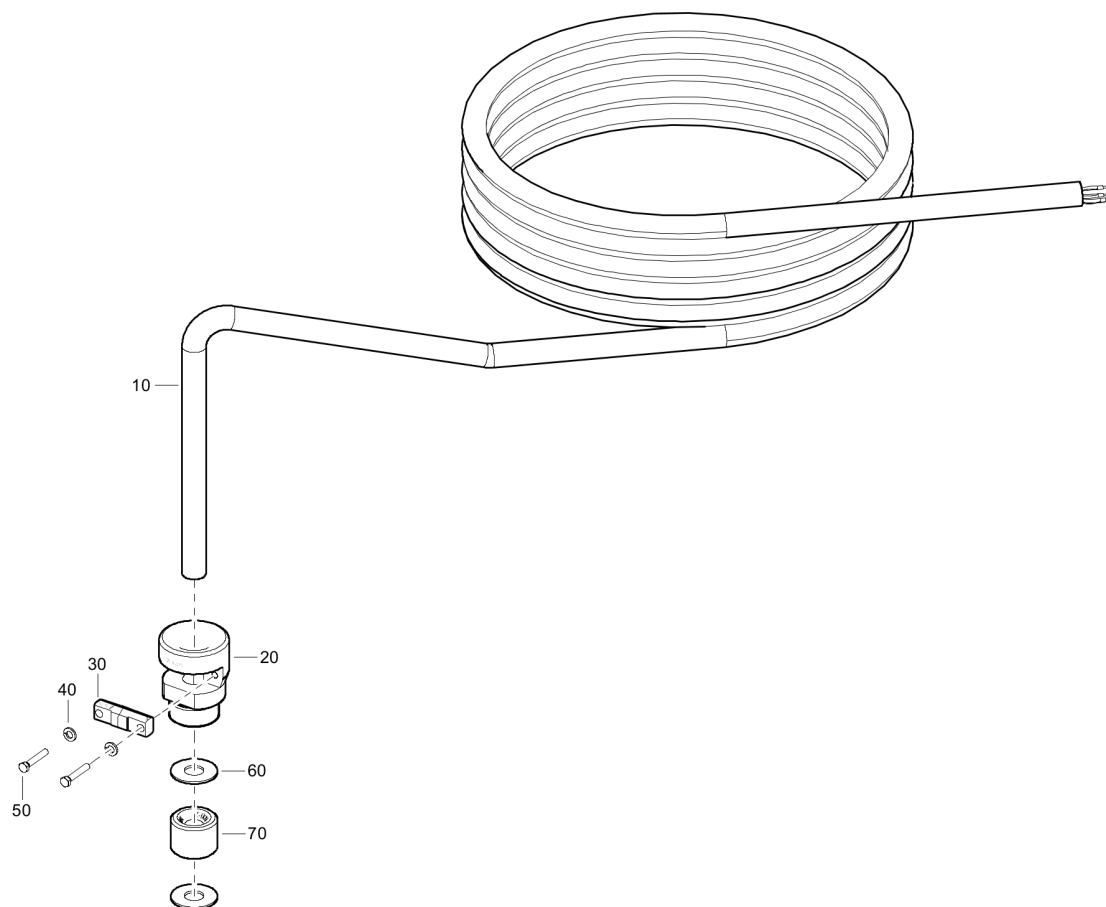


Refer to Parts Online for the most up to date information. The printed information might be outdated.

Fri Apr 24 06:39:01 UTC 2020


Item	Part No.	Name	Qty	L
10	1605226800	Cable 4G10mm ² 20m Ø20,9-24 mm	1	
20	3081600577	Cable inlet G1 1/4" cable Ø18-(26)mm	1	
30	3081600580	Strain relief for cable Ø16-(26) mm	1	
40	3081600590	Washer for cable Ø22-(24)mm	2	
50	4700W76290	Screw DIN933-M6x30-ISO:A2-70	2	
60	0333210837	Lock washer	2	
70	3081600524	Cable seal Cable Ø22-(24)mm	1	

Cable unit 4AWG10

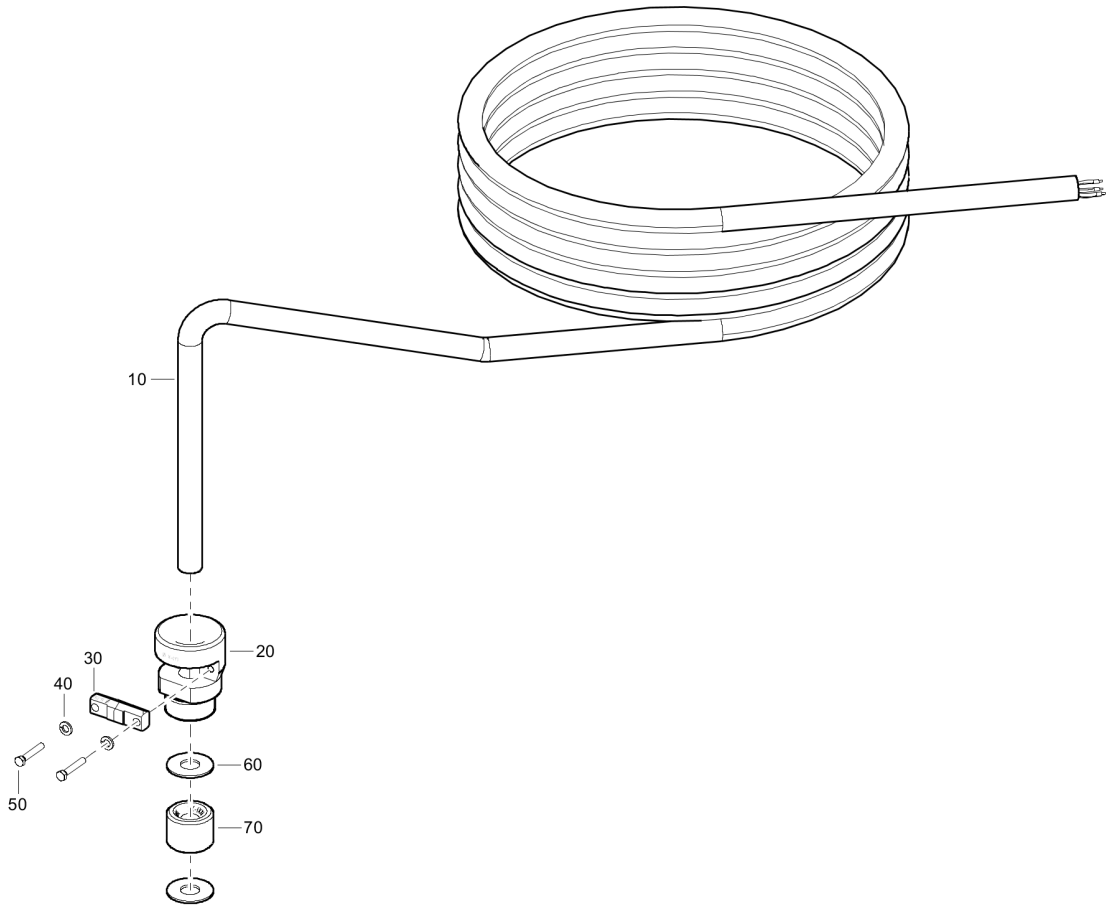


Item	Part No.	Name	Qty	L
10	1603494200	Cable kit 4AWG10 20m Ø13,9-15,5 mm S50/60N 460V	1	
20	3081600576	Cable inlet G1 1/4" cable Ø12-(18) mm	1	
30	3081600579	Strain relief for cable Ø12-(16) mm	1	
40	3081600587	Washer for cable Ø16-(18) mm	1	
50	4700W76290	Screw DIN933-M6x30-ISO:A2-70	2	
60	0333210837	Lock washer	2	
70	3081600521	Cable seal cable Ø16-(18) mm	1	

Cable unit 4AWG8

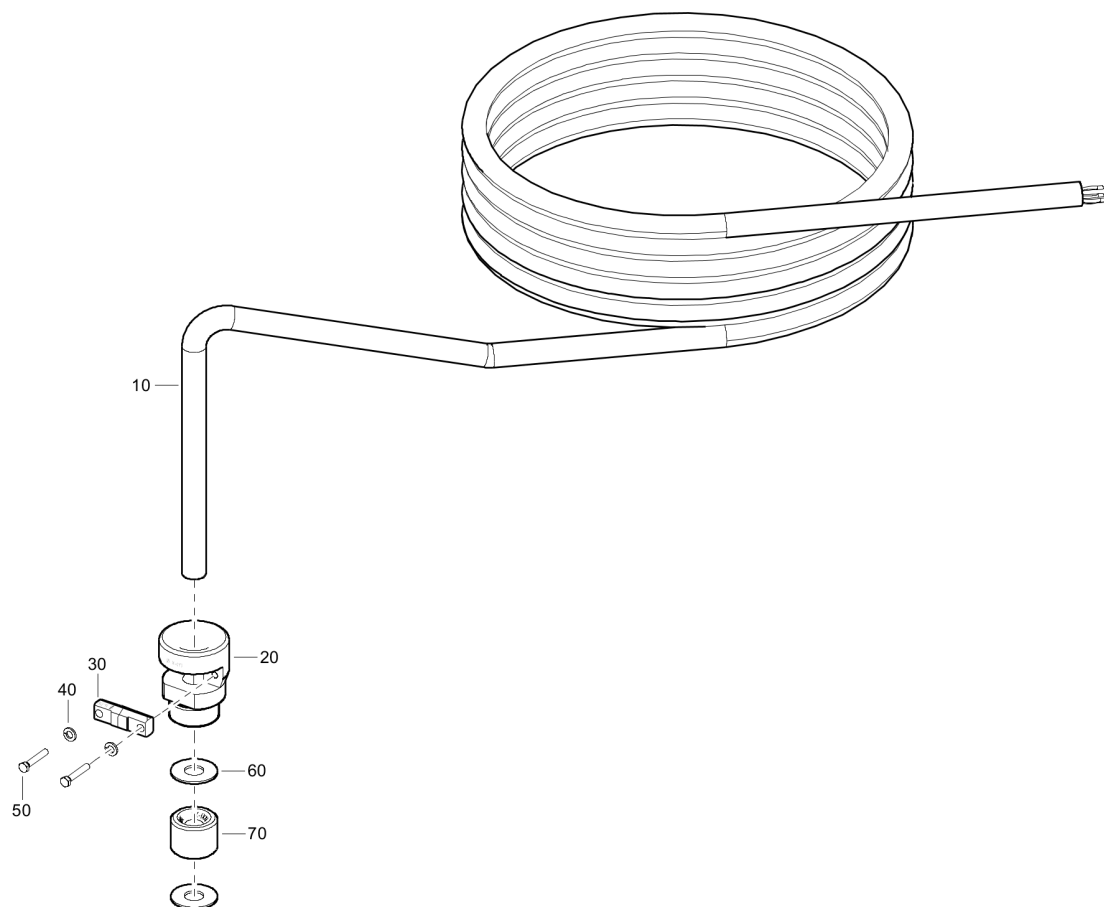

Item	Part No.	Name	Qty	L
10	1605231200	Cable 4AWG8, 65ft (20m) Ø0,669-0,74" (17-18,8 mm)	1	
20	3081600577	Cable inlet G1 1/4" cable Ø18-(26)mm	1	
30	3081600580	Strain relief for cable Ø16-(26) mm	1	
40	3081600590	Washer for cable Ø22-(24)mm	1	
50	4700W76269	Screw DIN933-M5x30-ISO:A2-70	2	
60	4700W58957	Washer DIN127-B5-ISO:A2	2	
70	3081600524	Cable seal Cable Ø22-(24)mm	1	

Cable unit

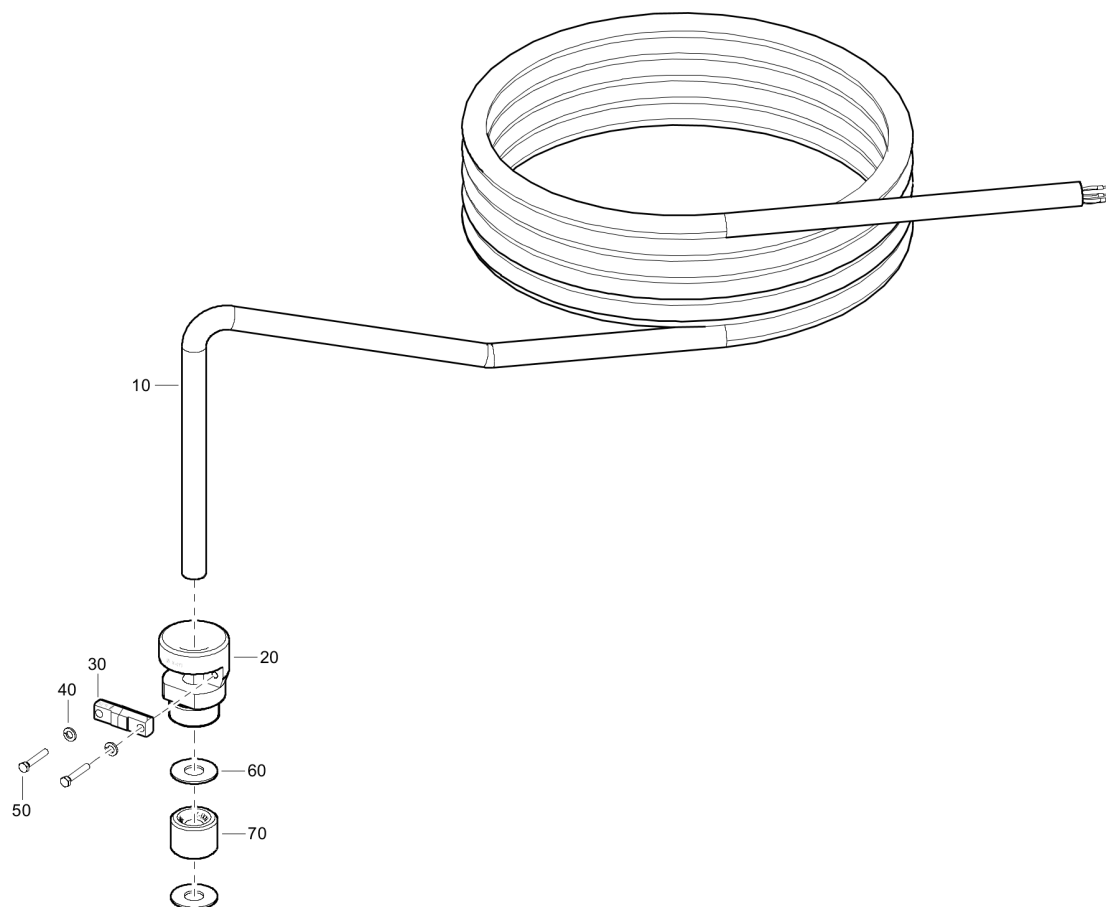


Refer to Parts Online for the most up to date information. The printed information might be outdated.

Fri Apr 24 06:39:03 UTC 2020


Item	Part No.	Name	Qty	L
10	3081601807	Cable 3X6+3X6/3E+3X1,5ST	1	
20	3081600577	Cable inlet G1 1/4" cable Ø18-(26)mm	1	
30	3081600580	Strain relief for cable Ø16-(26) mm	1	
40	3081600588	Washer for cable Ø18-(20)mm	1	
50	4700W76269	Screw DIN933-M5x30-ISO:A2-70	2	
60	0333210837	Lock washer	2	
70	3081600522	Cable seal Cable Ø18-(20)mm	1	

Plug kit

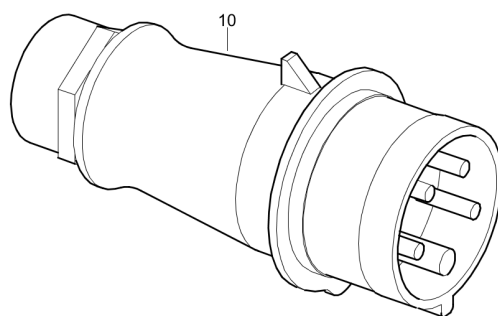

Item	Part No.	Name	Qty	L
10	1089049503	Plug CEE 32A 3P+N+E IP44	1	

Float switch unit

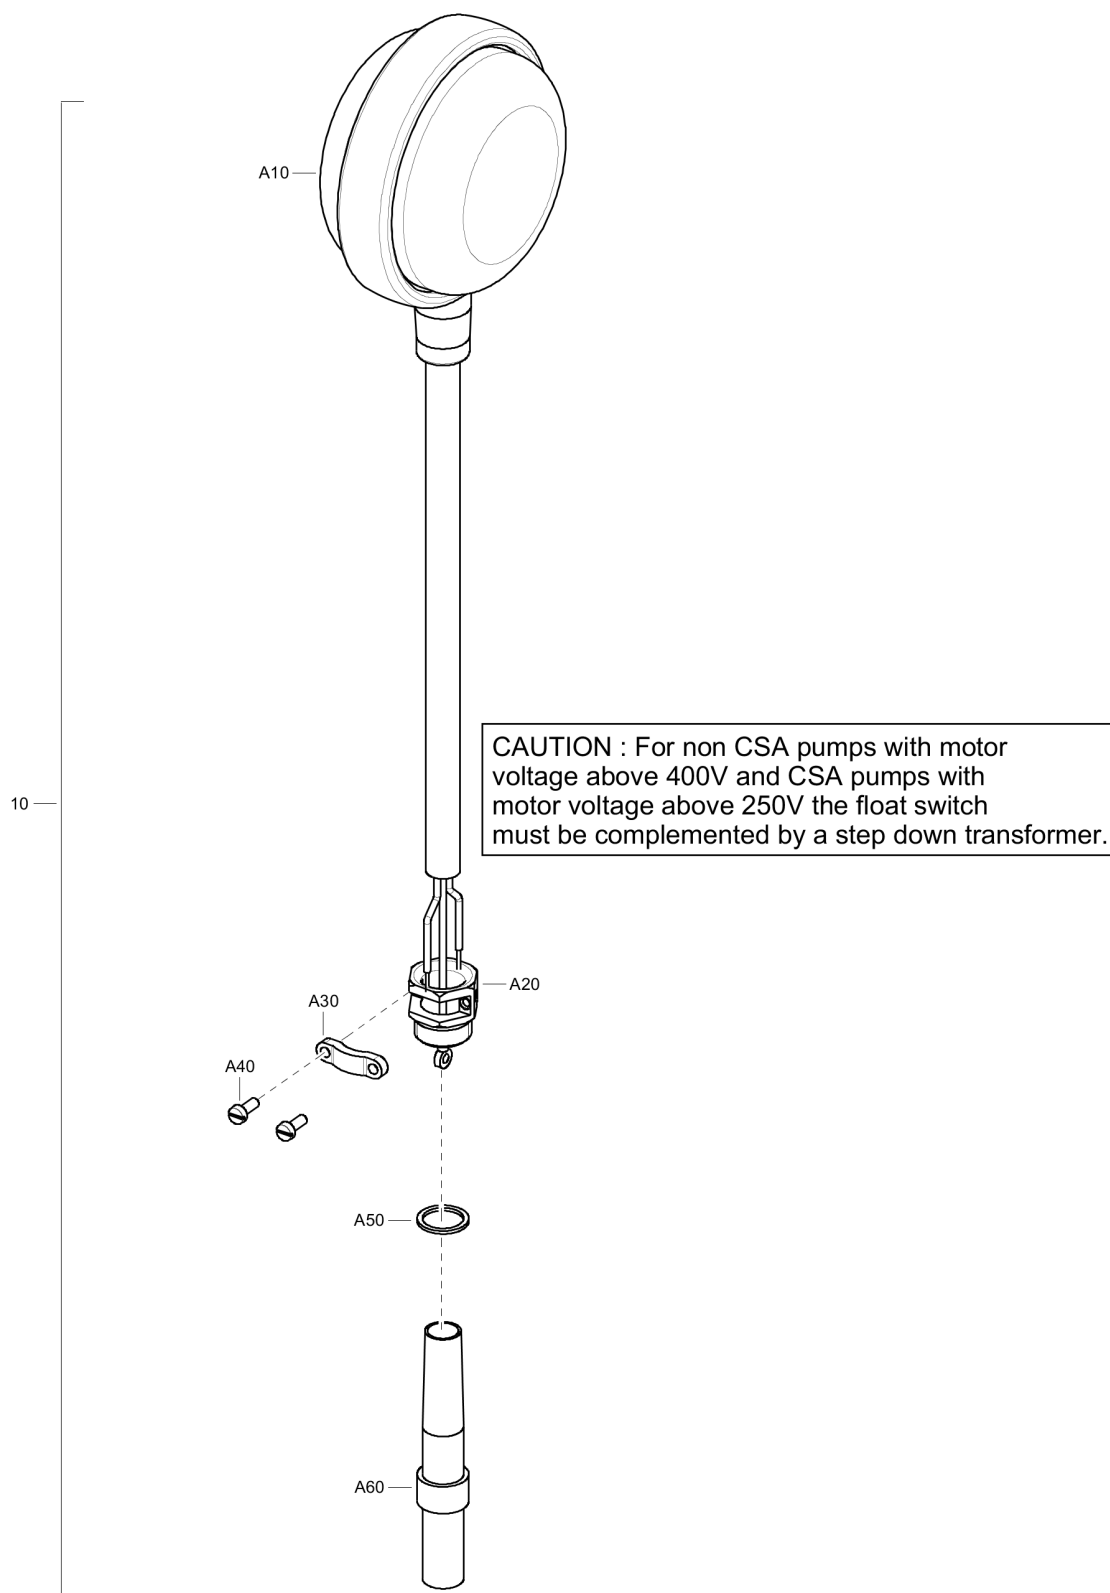


Refer to Parts Online for the most up to date information. The printed information might be outdated.

Fri Apr 24 06:39:04 UTC 2020


Item	Part No.	Name	Qty	L
10	-	Float switch unit	-	
-	3081690558	Float switch kit (CSA)	1	
-	3081690556	Float switch kit (CE)	1	
A10	-	Float switch	1	
-	3081602076	Float switch (CSA)	-	
-	1605261450	Float switch (CE)	-	
A20	470W214823	Cable inlet	1	
A30	470W214824	Cable keep	1	
A40	1633010809	Screw DIN 84 M3x8 A2 ISO 1207	2	
A50	470W214825	Washer	1	
A60	470W214826	Cable sleeve	1	

O-Ring kit

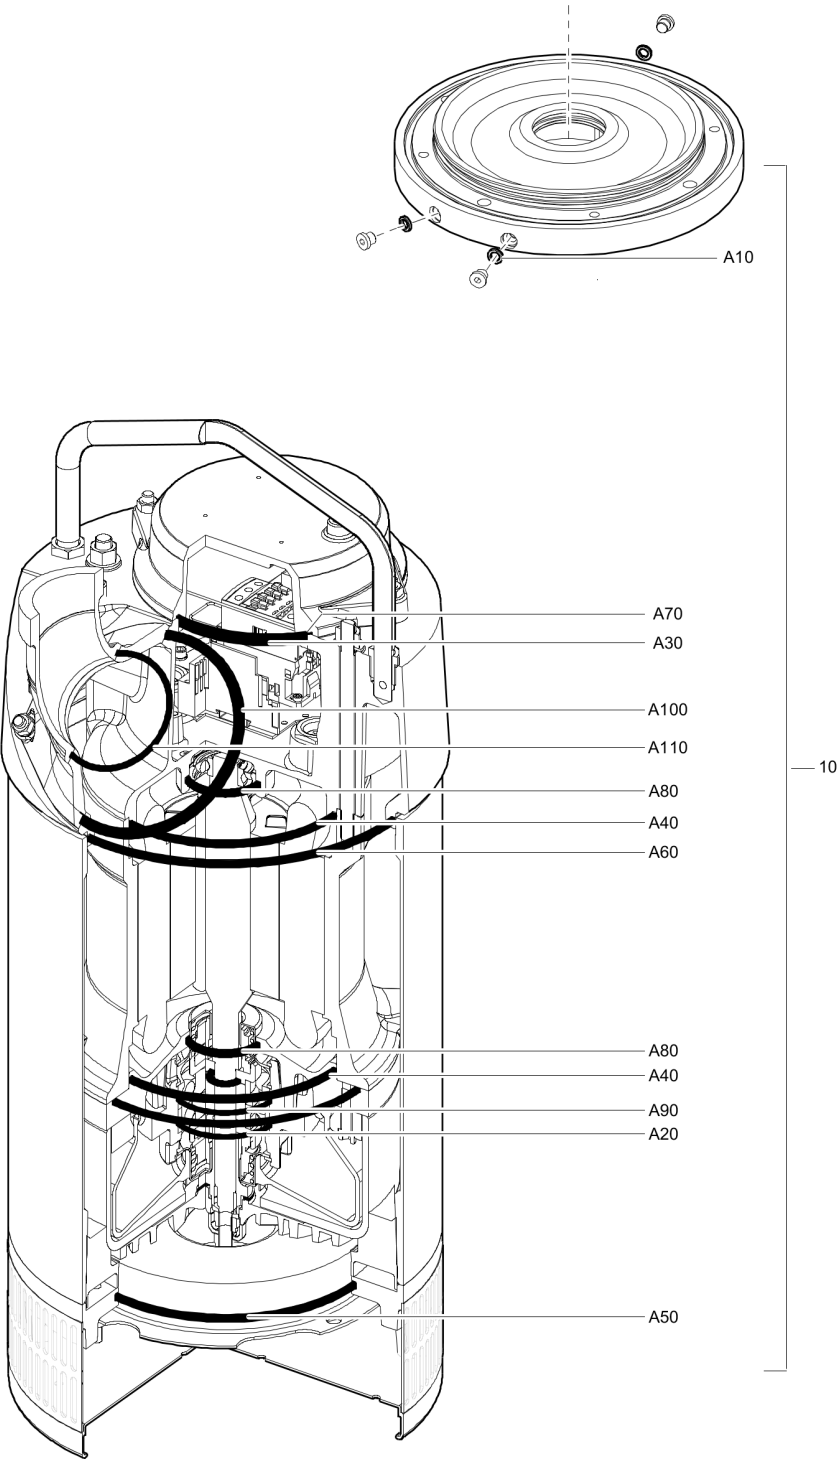

Item	Part No.	Name	Qty	L
10	470W274414	O-ring kit	1	
A10	4700W65006	O-ring 8,3X2,4-NBR 70 shore	3	
A20	4700W65108	O-ring 89,5X3-NBR 70 shore	2	
A30	4700W65130	O-ring 199,3X5,7-NBR 70 shore	1	
A40	4700W65131	O-ring 209,3X5,7-NBR 70 shore	1	
A50	4700W65136	O-ring 259,3X5,7-NBR 70 shore	1	
A60	4700W65141	O-ring 319,3X5,7-NBR 70 shore	1	
A70	4700W65164	O-ring 210X3-NBR 70 shore	1	
A80	470W274062	O-ring 62,2X5,7-NBR 70 shore	2	
A90	470W274086	O-ring 22X5-NBR 70 shore	2	
A100	470W284058	Gasket for discharge 6"	1	
A110	0663212097	O-ring 95X4 NBR 70 shore	1	

Zinc anode kit

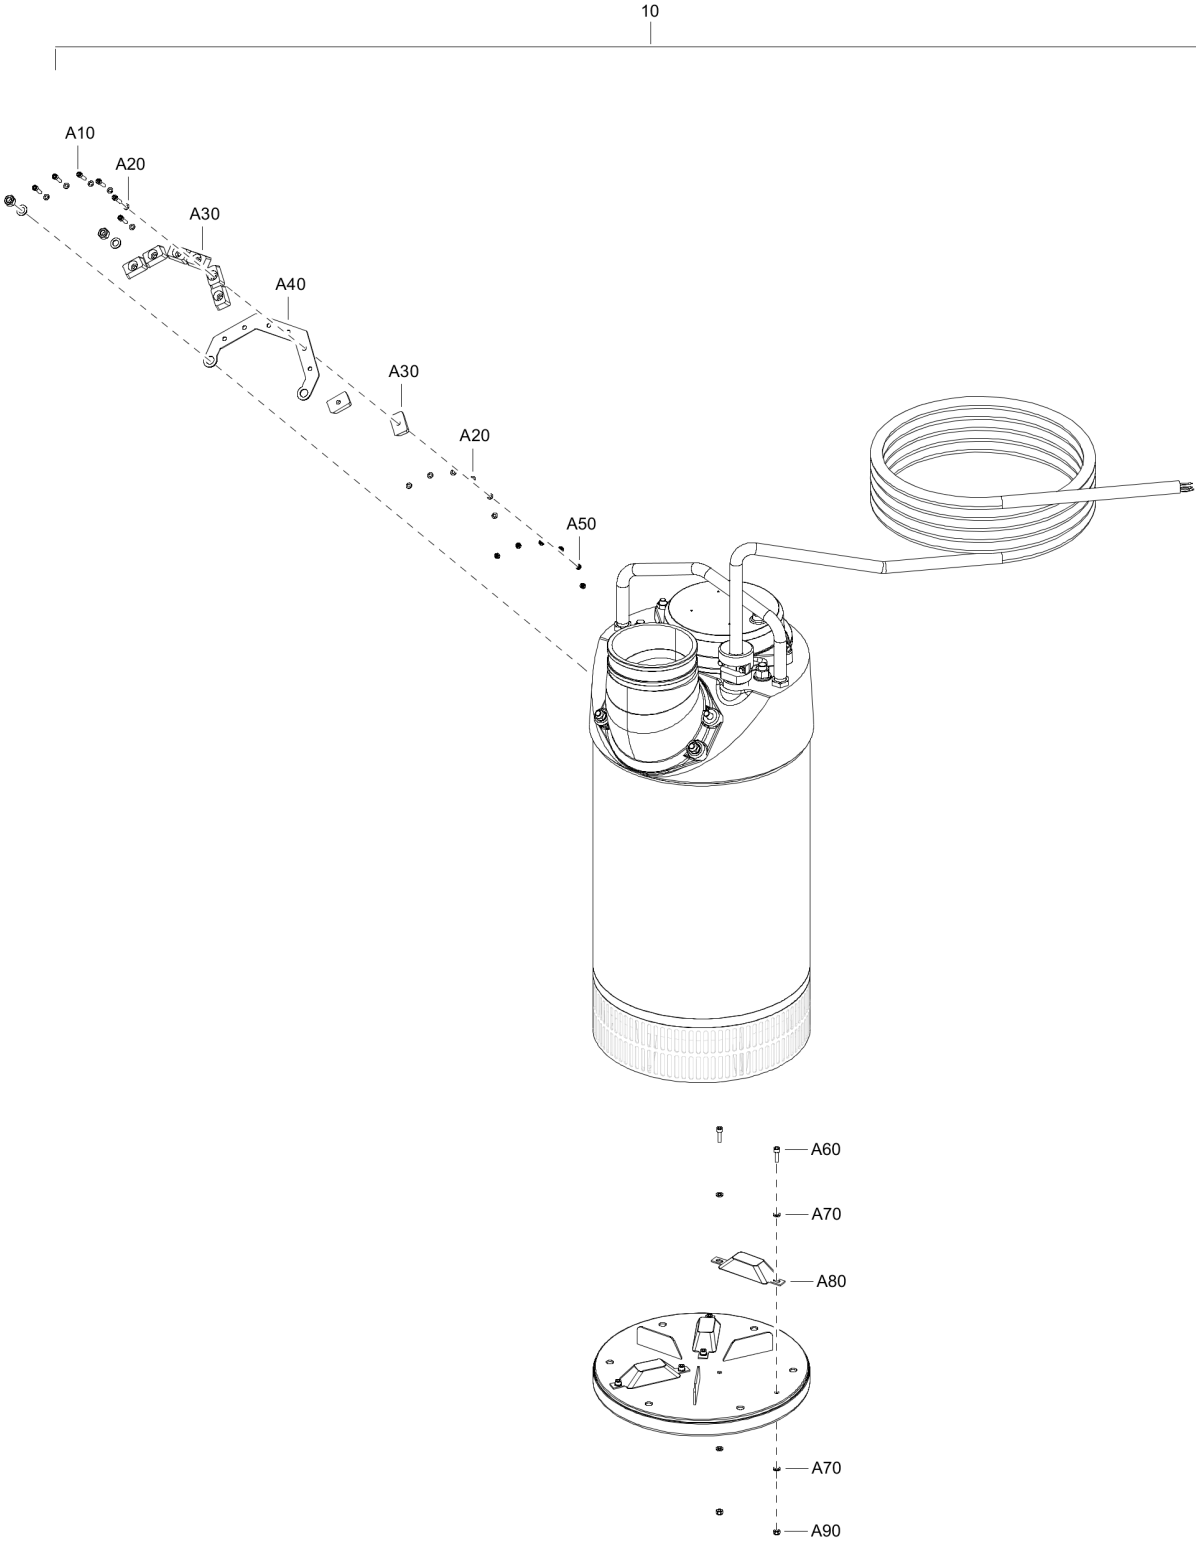

Refer to Parts Online for the most up to date information. The printed information might be outdated.

Fri Apr 24 06:39:06 UTC 2020

Item	Part No.	Name	Qty	L
10	3081690918	Zinc anode kit	1	
A10	3081600539	Screw DIN 912 M5X20 A2-70	6	
A20	0300012920	Washer	12	
A30	470W209275	Zinc anode	8	
A40	3081601172	Bracket	1	
A50	1633010649	Lock nut DIN 985 M5 A2 ISO 10511	6	
A60	3081600540	Screw DIN912 M6x20 A2-70	6	
A70	333210837	Washer DIN 127 Ø6,1 A2 S/ISO	12	
A80	470W209273	Zinc anode	3	
A90	1633010650	Lock nut DIN 985 M6 A2 ISO 10511	6	